

STURAA TEST

7 YEAR

200,000 MILE BUS

from

**GLAVAL BUS / DIVISION
of
FOREST RIVER INC.**

MODEL 28' TITAN II LF

AUGUST 2012

PTI-BT-R1120

PENNSSTATE



**The Thomas D. Larson
Pennsylvania Transportation Institute
Vehicle Systems and Safety Program**

201 Transportation Research Building (814) 865-1891
The Pennsylvania State University
University Park, PA 16802

Bus Testing and Research Center

2237 Old Route 220 N. (814) 695-3404
Duncansville, PA 16635



MECHANICAL TESTING
CERTIFICATE 3172.01

TABLE OF CONTENTS

	<u>Page</u>
EXECUTIVE SUMMARY	3
ABBREVIATIONS	5
BUS CHECK-IN	6
1. MAINTAINABILITY	
1.1 ACCESSIBILITY OF COMPONENTS AND SUBSYSTEMS	18
1.2 SERVICING, PREVENTATIVE MAINTENANCE, AND REPAIR AND MAINTENANCE DURING TESTING	21
1.3 REPLACEMENT AND/OR REPAIR OF SELECTED SUBSYSTEMS	25
2. RELIABILITY - DOCUMENTATION OF BREAKDOWN AND REPAIR TIMES DURING TESTING	29
3. SAFETY - A DOUBLE-LANE CHANGE (OBSTACLE AVOIDANCE TEST)	32
4. PERFORMANCE TESTS	
4.1 PERFORMANCE - AN ACCELERATION, GRADEABILITY, AND TOP SPEED TEST	35
4.2 PERFORMANCE – BUS BRAKING PERFORMANCE TEST	39
5. STRUCTURAL INTEGRITY	
5.1 STRUCTURAL STRENGTH AND DISTORTION TESTS - STRUCTURAL SHAKEDOWN TEST	44
5.2 STRUCTURAL STRENGTH AND DISTORTION TESTS - STRUCTURAL DISTORTION	48
5.3 STRUCTURAL STRENGTH AND DISTORTION TESTS - STATIC TOWING TEST	60
5.4 STRUCTURAL STRENGTH AND DISTORTION TESTS - DYNAMIC TOWING TEST	61
5.5 STRUCTURAL STRENGTH AND DISTORTION TESTS - JACKING TEST	64
5.6 STRUCTURAL STRENGTH AND DISTORTION TESTS - HOISTING TEST	66
5.7 STRUCTURAL DURABILITY TEST	68
6. FUEL ECONOMY TEST - A FUEL CONSUMPTION TEST USING AN APPROPRIATE OPERATING CYCLE	79
7. NOISE	
7.1 INTERIOR NOISE AND VIBRATION TESTS	94
7.2 EXTERIOR NOISE TESTS	99
8. EMISSIONS	106

EXECUTIVE SUMMARY

Glaval Bus/Division of Forest River Inc., submitted a model 28' Titan II LF, CNG-powered 11 seat (including the driver) 28-foot bus, for a 7 yr/200,000 mile STURAA test. The odometer reading at the time of delivery was 1,274 miles. Testing started on January 6, 2012 and was completed on August 20, 2012. The Check-In section of the report provides a description of the bus and specifies its major components.

The primary part of the test program is the Structural Durability Test, which also provides the information for the Maintainability and Reliability results. The Structural Durability Test was started on January 18, 2012 and was completed on June 6, 2012.

The interior of the bus is configured with seating for 11 passengers including the driver. **(Note: this test bus is not designed for standing passengers, therefore GVW and SLW are the same 12,720 lbs.)**. At 150 lbs per person, this load results in a measured gross vehicle weight of 12,720 lbs. The first segment of the Structural Durability Test was performed with the bus loaded to a gross vehicle weight (GVW) of 12,720 lbs. The middle segment was performed at a seated load weight (SLW) of 12,720 lbs and the final segment was performed at a curb weight (CW) of 11,100 lbs. Durability driving resulted in unscheduled maintenance and failures that involved a variety of subsystems. A description of failures, and a complete and detailed listing of scheduled and unscheduled maintenance is provided in the Maintainability section of this report.

Effective January 1, 2010 the Federal Transit Administration determined that the total number of simulated passengers used for loading all test vehicles will be based on the full complement of seats and free-floor space available for standing passengers (150 lbs per passenger). The passenger loading used for dynamic testing will not be reduced in order to comply with Gross Axle Weight Ratings (GAWR's) or the Gross Vehicle Weight Ratings (GVWR's) declared by the manufacturer. Cases where the loading exceeds the GAWR and/or the GVWR will be noted accordingly. During the testing program, all test vehicles transported or operated over public roadways will be loaded to comply with the GAWR and GVWR specified by the manufacturer.

Accessibility, in general, was adequate, components covered in Section 1.3 (Repair and/or Replacement of Selected Subsystems) along with all other components encountered during testing, were found to be readily accessible and no restrictions were noted.

The Reliability section compiles failures that occurred during Structural Durability Testing. Breakdowns are classified according to subsystems. The data in this section are arranged so that those subsystems with more frequent problems are apparent. The problems are also listed by class as defined in Section 2. The test bus encountered no Class 1 or Class 2 failures. Of the 15 reported failures, 12 were Class 3 and 3 were Class 4.

The Safety Test, (a double-lane change, obstacle avoidance test) was safely performed in both right-hand and left-hand directions up to a maximum test speed of 45

mph. The performance of the bus is illustrated by a speed vs. time plot. Acceleration and gradeability test data are provided in Section 4, Performance. The average time to obtain 50 mph was 16.97 seconds. The Stopping Distance phase of the Brake Test was completed with the following results; for the Uniform High Friction Test average stopping distances were 22.28' at 20 mph, 51.32' at 30 mph, 86.40' at 40 mph and 119.93' at 45 mph. The average stopping distance for the Uniform Low Friction Test was 23.62'. There was no deviation from the test lane during the performance of the Stopping Distance phase. During the Stability phase of Brake Testing the test bus experienced no deviation from the test lane but did experience pull to the left during both approaches to the Split Friction Road surface. The Parking Brake phase was completed with the test bus maintaining the parked position for the full five minute period with no slip or roll observed in both the uphill and downhill positions.

The Shakedown Test produced a maximum final loaded deflection of 0.179 inches with a permanent set ranging between -0.004 to 0.002 inches under a distributed static load of 4,125 lbs. The Distortion Test was completed with all subsystems, doors and escape mechanisms operating properly. No water leakage was observed throughout the test. All subsystems operated properly.

The test bus submitted for testing was not equipped with any type of tow eyes or tow hooks, therefore the Static Towing Test was not performed. The Dynamic Towing Test was performed by means of a front-lift tow. The towing interface was accomplished using a hydraulic under-lift wrecker. The bus was towed without incident and no damage resulted from the test. The manufacturer does not recommend towing the bus from the rear, therefore, a rear test was not performed. The Jacking and Hoisting Tests were also performed without incident. The bus was found to be stable on the jack stands, and the minimum jacking clearance observed with a tire deflated was 3.1 inches.

A Fuel Economy Test was run on simulated central business district, arterial, and commuter courses. The results were 1.86 m/lb, 2.48 m/lb, and 4.01 m/lb respectively; with an overall average of 2.40 m/lb.

A series of Interior and Exterior Noise Tests was performed. These data are listed in Section 7.1 and 7.2 respectively.

The Emissions Test was performed. These results are available in Section 8 of this report.

ABBREVIATIONS

ABTC	- Altoona Bus Test Center
A/C	- air conditioner
ADB	- advance design bus
ATA-MC	- The Maintenance Council of the American Trucking Association
CBD	- central business district
CW	- curb weight (bus weight including maximum fuel, oil, and coolant; but without passengers or driver)
dB(A)	- decibels with reference to 0.0002 microbar as measured on the "A" scale
DIR	- test director
DR	- bus driver
EPA	- Environmental Protection Agency
FFS	- free floor space (floor area available to standees, excluding ingress/egress areas, area under seats, area occupied by feet of seated passengers, and the vestibule area)
GVL	- gross vehicle load (150 lb for every designed passenger seating position, for the driver, and for each 1.5 sq ft of free floor space)
GVW	- gross vehicle weight (curb weight plus gross vehicle load)
GVWR	- gross vehicle weight rating
MECH	- bus mechanic
mpg	- miles per gallon
mph	- miles per hour
PM	- Preventive maintenance
PSBRTF	- Penn State Bus Research and Testing Facility
PTI	- Pennsylvania Transportation Institute
rpm	- revolutions per minute
SAE	- Society of Automotive Engineers
SCH	- test scheduler
SEC	- secretary
SLW	- seated load weight (curb weight plus 150 lb for every designed passenger seating position and for the driver)
STURAA	- Surface Transportation and Uniform Relocation Assistance Act
TD	- test driver
TECH	- test technician
TM	- track manager
TP	- test personnel

TEST BUS CHECK-IN

I. OBJECTIVE

The objective of this task is to log in the test bus, assign a bus number, complete the vehicle data form, and perform a safety check.

II. TEST DESCRIPTION

The test consists of assigning a bus test number to the bus, cleaning the bus, completing the vehicle data form, obtaining any special information and tools from the manufacturer, determining a testing schedule, performing an initial safety check, and performing the manufacturer's recommended preventive maintenance. The bus manufacturer must certify that the bus meets all Federal regulations.

III. DISCUSSION

The check-in procedure is used to identify in detail the major components and configuration of the bus.

The test bus consists of a Glaval Bus/Division of Forest River Inc., model 28' Titan II LF. The bus has an OEM driver's door rear of the front axle and a passenger door equipped with a Ricon model BR2C02-000000000 manual fold-out ramp rear of the front axle. Power is provided by a CNG-fueled, General Motors 6.0 L engine coupled to a General Motors 6 Speed transmission.

The measured curb weight is 3,780 lbs for the front axle and 7,320 lbs for the rear axle. These combined weights provide a total measured curb weight of 11,100 lbs. There are 11 seats including the driver. **(Note; this test bus is not designed for standing passengers, therefore GVW and SLW are the same 12,720 lbs.).** Gross load is $150 \text{ lb} \times 11 = 1,650 \text{ lbs}$. At full capacity, the measured gross vehicle weight is 12,720 lbs.

VEHICLE DATA FORM

Page 1 of 7

Bus Number: 1120	Arrival Date: 1-6-12
Bus Manufacturer: Glaval Bus	Vehicle Identification Number (VIN): 1GB6G5CG4B1111132
Model Number: 28' Titan II LF	Date: 1-6-12
Personnel: E.D.& E.L.	Chassis Mfr. / Model No. Chevy / 4500

WEIGHT:

Individual Wheel Reactions:

Weights (lb)	Front Axle		Middle Axle		Rear Axle	
	Right	Left	Right	Left	Right	Left
CW	1,870	1,910	N/A	N/A	3,810	3,510
SLW	2,040	2,110	N/A	N/A	4,560	4,010
GVW	2,040	2,110	N/A	N/A	4,560	4,010

Total Weight Details:

Weight (lb)	CW	SLW	GVW	GAWR
Front Axle	3,780	4,150	4,150	4,600
Middle Axle	N/A	N/A	N/A	N/A
Rear Axle	7,320	8,570	8,570	9,600
Total	11,100	12,720	12,720	GVWR: 14,200

Dimensions:

Length (ft/in)	28 / 3.0
Width (in)	98.0
Height (in)	113.5
Front Overhang (in)	39.3
Rear Overhang (in)	85.8
Wheel Base (in)	214.0
Wheel Track (in)	Front: 68.6
	Rear: 74.8

VEHICLE DATA FORM

Page 2 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

CLEARANCES:

Lowest Point Outside Front Axle	Location: Spoiler	Clearance(in): 10.4
Lowest Point Outside Rear Axle	Location: Exhaust	Clearance(in): 10.1
Lowest Point between Axles	Location: Passenger door	Clearance(in): 7.0
Ground Clearance at the center (in)	7.4	
Front Approach Angle (deg)	14.8	
Rear Approach Angle (deg)	6.7	
Ramp Clearance Angle (deg)	3.7	
Aisle Width (in)	16.0	
Inside Standing Height at Center Aisle (in)	82.5	

BODY DETAILS:

Body Structural Type	Integral		
Frame Material	Steel		
Body Material	Composite		
Floor Material	Plywood		
Roof Material	Composite		
Windows Type	☒ Fixed bottom	☒ Movable Top	
Window Mfg./Model No.	KTG / AS3 M3 DOT 620 ANSI 297.1-1984		
Number of Doors	<u>1</u> Front (driver)	<u>1</u> Rear (Passenger)	
Mfr. / Model No.	Chevy / OEM	Not available.	
Dimension of Each Door (in)	56.2 x 28.9	76.7 x 34.3	
Passenger Seat Type	☐ Cantilever	☒ Pedestal	☐ Other (explain)
Mfr. / Model No.	Freedman Seating Co. / Na		
Driver Seat Type	☐ Air	☒ Spring	☐ Other (explain)
Mfr. / Model No.	Chevy / OEM		
Number of Seats (including Driver)	11		

VEHICLE DATA FORM

Page 3 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

BODY DETAILS (Contd..)

Free Floor Space (ft ²)					
Height of Each Step at Normal Position (in)	Front	1. <u>14.3</u>	2. <u>N/A</u>	3. <u>N/A</u>	4. <u>N/A</u>
	Middle	1. <u>N/A</u>	2. <u>N/A</u>	3. <u>N/A</u>	4. <u>N/A</u>
	Rear	1. <u>N/A</u>	2. <u>N/A</u>	3. <u>N/A</u>	4. <u>N/A</u>
Step Elevation Change - Kneeling (in)	3.0				

ENGINE

Type	☐ C.I.	☐ Alternate Fuel	
	☒ S.I.	☐ Other (explain)	
Mfr. / Model No.	General Motors / 6.0 L		
Location	☒ Front	☐ Rear	☐ Other (explain)
Fuel Type	☐ Gasoline	☒ CNG	☐ Methanol
	☐ Diesel	☐ LNG	☐ Other (explain)
Fuel Tank Capacity (indicate units)	8,462.5 Scf @ 3,600 Psi		
Fuel Induction Type	☒ Injected	☐ Carburetion	
Fuel Injector Mfr. / Model No.	General Motors / 6.0 L		
Carburetor Mfr. / Model No.	General Motors / 6.0 L		
Fuel Pump Mfr. / Model No.	N/A		
Alternator (Generator) Mfr. / Model No.	Penntex / PX-4V-220		
Maximum Rated Output (Volts / Amps)	12 / 200		
Air Compressor Mfr. / Model No.	Oasis Mfg. / YC4000		
Maximum Capacity (ft ³ / min)	Not available.		
Starter Type	☒ Electrical	☐ Pneumatic	☐ Other (explain)
Starter Mfr. / Model No.	Chevy / OEM		

VEHICLE DATA FORM

Page 4 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

TRANSMISSION

Transmission Type	☐ Manual	☒ Automatic
Mfr. / Model No.	GM / 6 Speed Auto	
Control Type	☒ Mechanical	☐ Electrical ☐ Other
Torque Converter Mfr. / Model No.	GM / 6 Speed Auto	
Integral Retarder Mfr. / Model No.	N/A	

SUSPENSION

Number of Axles	2		
Front Axle Type	☒ Independent	☐ Beam Axle	
Mfr. / Model No.	Link Mfg. / 8M000126		
Axle Ratio (if driven)	N/A		
Suspension Type	☒ Air	☐ Spring	☐ Other (explain)
No. of Shock Absorbers	2		
Mfr. / Model No.	Tenneco / WO 79583		
Middle Axle Type	☐ Independent	☐ Beam Axle	
Mfr. / Model No.	N/A		
Axle Ratio (if driven)	N/A		
Suspension Type	☐ Air	☐ Spring	☐ Other (explain)
No. of Shock Absorbers	N/A		
Mfr. / Model No.	N/A		
Rear Axle Type	☐ Independent	☒ Beam Axle	
Mfr. / Model No.	Link Mfg. / 8M000115		
Axle Ratio (if driven)	4:10		
Suspension Type	☒ Air	☐ Spring	☐ Other (explain)
No. of Shock Absorbers	2		
Mfr. / Model No.	Link Cabmate / 1210-0516		

VEHICLE DATA FORM

Page 5 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

WHEELS & TIRES

Front	Wheel Mfr./ Model No.	Accuride / 16
	Tire Mfr./ Model No.	Uniroyal-Laredo / LT 225/75R 16
Rear	Wheel Mfr./ Model No.	Accuride / 16
	Tire Mfr./ Model No.	Uniroyal-Laredo / LT 225/75R 16

BRAKES

Front Axle Brakes Type	☐ Cam	☒ Disc	☐ Other (explain)
Mfr. / Model No.	Chevy / OEM		
Middle Axle Brakes Type	☐ Cam	☐ Disc	☐ Other (explain)
Mfr. / Model No.	N/A		
Rear Axle Brakes Type	☐ Cam	☒ Disc	☐ Other (explain)
Mfr. / Model No.	Chevy / OEM		
Retarder Type	N/A		
Mfr. / Model No.	N/A		

HVAC

Heating System Type	☐ Air	☒ Water	☐ Other
Capacity (Btu/hr)	65,000		
Mfr. / Model No.	ACT / 50 000 494		
Air Conditioner	☒ Yes	☐ No	
Location	Front & rear		
Capacity (Btu/hr)	Not available.		
A/C Compressor Mfr. / Model No.	Front – Carrier / AC13R4M Rear - Carrier / AC13R4M		

STEERING

Steering Gear Box Type	Hydraulic gear
Mfr. / Model No.	Chevy / OEM
Steering Wheel Diameter	15.3
Number of turns (lock to lock)	3.3

VEHICLE DATA FORM

Page 6 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

OTHERS

Wheel Chair Ramps	Location: Front	Type: Manual fold-out
Wheel Chair Lifts	Location: N/A	Type: N/A
Mfr. / Model No.	Ricon / BR2C02-000000000	
Emergency Exit	Location: Windows Doors Roof hatch	Number: 4 2 1

CAPACITIES

Fuel Tank Capacity (units)	8462.5 Scf @ 3,600 Psi
Engine Crankcase Capacity (gallons)	OEM
Transmission Capacity (gallons)	OEM
Differential Capacity (gallons)	OEM
Cooling System Capacity (quarts)	OEM
Power Steering Fluid Capacity (quarts)	OEM

OTHERS

CNG Fuel Tanks Mfr. / Model No.	Lincoln Composites / RH36A21-080MG (2 tanks) Lincoln Composites / RH36B18-03635 (1 Tank)
---------------------------------	---

VEHICLE DATA FORM

Page 7 of 7

Bus Number: 1120	Date: 1-6-12
------------------	--------------

List all spare parts, tools and manuals delivered with the bus.

[illegible]

COMPONENT/SUBSYSTEM INSPECTION FORM

Page 1 of 1

Bus Number: 1120	Date: 1-6-12
------------------	--------------

Subsystem	Checked	Initials	Comments
Air Conditioning Heating and Ventilation	✓	E.D.	
Body and Sheet Metal	✓	E.D.	Dent in step well. Body cracked on right side between axles on lower panel.
Frame	✓	E.D.	
Steering	✓	E.D.	
Suspension	✓	E.D.	
Interior/Seating	✓	E.D.	
Axles	✓	E.D.	
Brakes	✓	E.D.	
Tires/Wheels	✓	E.D.	
Exhaust	✓	E.D.	
Fuel System	✓	E.D.	
Power Plant	✓	E.D.	
Accessories	✓	E.D.	
Lift System	✓	E.D.	
Interior Fasteners	✓	E.D.	
Batteries	✓	E.D.	

CHECK - IN



**GLAVAL BUS / DIVISION of FOREST RIVER INC.,
MODEL 28' TITAN II LF**



CHECK - IN CONT.



**GLAVAL BUS / DIVISION of OREST RIVER INC.,
MODEL 28' TITAN II LF EQUIPPED WITH A
RICON MODEL BR2C02-000000000 FOLD-OUT
HANDICAP RAMP**



CHECK - IN CONT.



OPERATOR'S AREA

VIN/NTV 5NHBGFD26BF012296 1GB6G5CG4B1111132 CLB8328
GVWR/PNBV: 6441 KG (14200 LB) TYPE/TYPE BUS/AUTOBUS
DESIG. SEAT CAP./NOMBRE D'ESIGNE' DE PLACES ASSISES 13X68kg=884 kg or 13X150lbs=1950 lbs

CAVRPNEE	TRES/NEU	RMS/ANTE	COLD INFL PRESS/PRESS DE CONF. A FROID
FRONT/AVANT (2087 KG 4600 LB)	225/75R16E	16X6K	448 KP SINGLE DUAL 65 PSI/LP ☐ ☐
INTERM/INTERM (0 KG 0 LB)			0 KP SINGLE DUAL 0 PSI/LP ☐ ☐
REAR/ARRIERE (4355 KG 9600 LB)	225/75R16E	16X6K	414 KP SINGLE DUAL 60 PSI/LP ☐ ☐

VIN TAG

CHECK - IN CONT.



INTERIOR



CHECK - IN CONT.



ENGINE COMPARTMENT

1. MAINTAINABILITY

1.1 ACCESSIBILITY OF COMPONENTS AND SUBSYSTEMS

1.1-I. TEST OBJECTIVE

The objective of this test is to check the accessibility of components and subsystems.

1.1-II. TEST DESCRIPTION

Accessibility of components and subsystems is checked, and where accessibility is restricted the subsystem is noted along with the reason for the restriction.

1.1-III. DISCUSSION

Accessibility, in general, was adequate. Components covered in Section 1.3 (repair and/or replacement of selected subsystems), along with all other components encountered during testing, were found to be readily accessible and no restrictions were noted.

ACCESSIBILITY DATA FORM

Page 1 of 2

Bus Number: 1120	Date: 8-3-12
------------------	--------------

Component	Checked	Initials	Comments
ENGINE :			
Oil Dipstick	✓	E.D.	
Oil Filler Hole	✓	E.D.	
Oil Drain Plug	✓	E.D.	
Oil Filter	✓	E.D.	
Fuel Filter	✓	E.D.	
Air Filter	✓	E.D.	
Belts	✓	E.D.	
Coolant Level	✓	E.D.	
Coolant Filler Hole	✓	E.D.	
Coolant Drain	✓	E.D.	
Spark / Glow Plugs	✓	E.D.	
Alternator	✓	E.D.	
Diagnostic Interface Connector	✓	E.D.	
TRANSMISSION :			
Fluid Dip-Stick	✓	E.D.	
Filler Hole	✓	E.D.	
Drain Plug	✓	E.D.	
SUSPENSION :			
Bushings	✓	E.D.	
Shock Absorbers	✓	E.D.	
Air Springs	✓	E.D.	
Leveling Valves	✓	E.D.	
Grease Fittings	✓	E.D.	

ACCESSIBILITY DATA FORM

Page 2 of 2

Bus Number: 1120	Date: 8-3-12
------------------	--------------

Component	Checked	Initials	Comments
HVAC :			
A/C Compressor	✓	E.D.	
Filters	✓	E.D.	
Fans	✓	E.D.	
ELECTRICAL SYSTEM :			
Fuses	✓	E.D.	
Batteries	✓	E.D.	
Voltage regulator	✓	E.D.	
Voltage Converters	N/A	E.D.	
Lighting	✓	E.D.	
MISCELLANEOUS :			
Brakes	✓	E.D.	
Handicap Lifts/Ramps	✓	E.D.	
Instruments	✓	E.D.	
Axles	✓	E.D.	
Exhaust	✓	E.D.	
Fuel System	✓	E.D.	
OTHERS :			

1.2 SERVICING, PREVENTIVE MAINTENANCE, AND REPAIR AND MAINTENANCE DURING TESTING

1.2-I. TEST OBJECTIVE

The objective of this test is to collect maintenance data about the servicing, preventive maintenance, and repair.

1.2.-II. TEST DESCRIPTION

The test will be conducted by operating the NBM and collecting the following data on work order forms and a driver log.

1. Unscheduled Maintenance
 - a. Bus number
 - b. Date
 - c. Mileage
 - d. Description of malfunction
 - e. Location of malfunction (e.g., in service or undergoing inspection)
 - f. Repair action and parts used
 - g. Man-hours required
2. Scheduled Maintenance
 - a. Bus number
 - b. Date
 - c. Mileage
 - d. Engine running time (if available)
 - e. Results of scheduled inspections
 - f. Description of malfunction (if any)
 - g. Repair action and parts used (if any)
 - h. Man-hours required

The buses will be operated in accelerated durability service. While typical items are given below, the specific service schedule will be that specified by the manufacturer.

- A. Service
 1. Fueling
 2. Consumable checks
 3. Interior cleaning
- B. Preventive Maintenance
 4. Brake adjustments
 5. Lubrication
 6. 3,000 mi (or equivalent) inspection

7. Oil and filter change inspection
8. Major inspection
9. Tune-up

C. Periodic Repairs

1. Brake reline
2. Transmission change
3. Engine change
4. Windshield wiper motor change
5. Stoplight bulb change
6. Towing operations
7. Hoisting operations

1.2-III. DISCUSSION

Servicing and preventive maintenance were performed at manufacturer-specified intervals. The following Scheduled Maintenance Form lists the mileage, items serviced, the service interval, and amount of time required to perform the maintenance. Table 1 is a list of the lubricating products used in servicing. Finally, the Unscheduled Maintenance List along with Unscheduled Maintenance-related photographs is included in Section 5.7, Structural Durability. This list supplies information related to failures that occurred during the durability portion of testing. The Unscheduled Maintenance List includes the date and mileage at which the malfunction occurred, a description of the malfunction and repair, and the time required to perform the repair.

(Page 1 of 1)
SCHEDULED MAINTENANCE
 Glaval Bus #1120

DATE	TEST MILES	SERVICE	ACTIVITY	DOWN TIME	HOURS
03-28-12	758	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
04-03-12	1,638	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
04-09-12	2,319	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
05-09-12	3,986	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
05-23-12	5,054	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
06-01-12	5,940	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
06-06-12	7,105	P.M. / Inspection	Linkage, tie rods, universals/u-joints all lubed; all fluids checked.	4.00	4.00
07-31-12	7,509	P.M. / Inspection Fuel Economy Prep	Linkage, tie rods, universals/u-joints all lubed. Oil changed. Oil, fuel, and air filters changed. Transmission oil and filter changed.	8.00	8.00

Table 1. STANDARD LUBRICANTS

The following is a list of Texaco lubricant products used in bus testing conducted by the Penn State University Altoona Bus Testing Center:

<u>ITEM</u>	<u>PRODUCT CODE</u>	<u>TEXACO DESCRIPTION</u>
Engine oil	#2112	URSA Super Plus SAE 30
Transmission oil	#1866	Automatic Trans Fluid Mercon/Dexron II Multipurpose
Gear oil	#2316	Multigear Lubricant EP SAE 80W90
Wheel bearing & Chassis grease	#1935	Starplex II

1.3 REPLACEMENT AND/OR REPAIR OF SELECTED SUBSYSTEMS

1.3-I. TEST OBJECTIVE

The objective of this test is to establish the time required to replace and/or repair selected subsystems.

1.3-II. TEST DESCRIPTION

The test will involve components that may be expected to fail or require replacement during the service life of the bus. In addition, any component that fails during the NBM testing is added to this list. Components to be included are:

1. Transmission
2. Alternator
3. Starter
4. Batteries
5. Windshield wiper motor

1.3-III. DISCUSSION

During the test, several additional components were removed for repair or replacement. Following is a list of components and total repair/replacement time.

	<u>MAN HOURS</u>
Both front sway bar clamps.	1.0
Battery tray.	2.0
Both front air bags.	3.0
Right rear sway bar link and link bracket.	2.0
Left panel of passenger door.	1.0

At the end of the test, the remaining items on the list were removed and replaced. The transmission assembly took 8.0 man-hours (two men 4.0 hrs) to remove and replace. The time required for repair/replacement of the four remaining components is given on the following Repair and/or Replacement Form.

REPLACEMENT AND/OR REPAIR FORM

Page 1 of 1

Subsystem	Replacement Time
Transmission	8.00 man hours
Wiper Motor	0.50 man hours
Starter	0.50 man hours
Alternator	0.50 man hours
Batteries	0.50 man hours

1.3 REPLACEMENT AND/OR REPAIR OF SELECTED SUBSYSTEMS



**TRANSMISSION REMOVAL AND REPLACEMENT
(8.00 MAN HOURS)**



**WIPER MOTOR REMOVAL AND REPLACEMENT
(0.50 MAN HOURS)**

1.3 REPLACEMENT AND/OR REPAIR OF SELECTED SUBSYSTEMS CONT.



STARTER REMOVAL AND REPLACEMENT (0.50 MAN HOURS)



ALTERNATOR REMOVAL AND REPLACEMENT (0.50 MAN HOURS)

2. RELIABILITY - DOCUMENTATION OF BREAKDOWN AND REPAIR TIMES DURING TESTING

2-I. TEST OBJECTIVE

The objective of this test is to document unscheduled breakdowns, repairs, down time, and repair time that occur during testing.

2-II. TEST DESCRIPTION

Using the driver log and unscheduled work order forms, all significant breakdowns, repairs, man-hours to repair, and hours out of service are recorded on the Reliability Data Form.

CLASS OF FAILURES

Classes of failures are described below:

- (a) Class 1: Physical Safety. A failure that could lead directly to passenger or driver injury and represents a severe crash situation.
- (b) Class 2: Road Call. A failure resulting in an en route interruption of revenue service. Service is discontinued until the bus is replaced or repaired at the point of failure.
- (c) Class 3: Bus Change. A failure that requires removal of the bus from service during its assignments. The bus is operable to a rendezvous point with a replacement bus.
- (d) Class 4: Bad Order. A failure that does not require removal of the bus from service during its assignments but does degrade coach operation. The failure shall be reported by driver, inspector, or hostler.

2-III. DISCUSSION

A listing of breakdowns and unscheduled repairs is accumulated during the Structural Durability Test. The following Reliability Data Form lists all unscheduled repairs under classes as defined above. These classifications are somewhat subjective as the test is performed on a test track with careful inspections every two hours. However, even on the road, there is considerable latitude on deciding how to handle many failures.

The Unscheduled Repair List is also attached to provide a reference for the repairs that are included in the Reliability Data Forms.

The classification of repairs according to subsystem is intended to emphasize those systems which had persistent minor or more serious problems. There were no Class 1 or 2 failures. Of the 12 Class 3 failures, five involved the suspension system, three occurred with the frame, two with the windows and one each with the air conditioning and exhaust system. These, and the remaining three Class 4 failures are available for review in the Unscheduled Maintenance List, located in Section 5.7 Structural Durability.

RELIABILITY DATA FORMS

Bus Number : 1120	Date: 06-06-12
Personnel: Bob Reifsteck	

Failure Type			
Class 4 Bad Order	Class 3 Bus Change	Class 2 Road Call	Class 1 Physical Safety

Subsystems	Mileage	Mileage	Mileage	Mileage	Man Hours	Down Time
Suspension		31			1.00	1.00
		75			2.00	18.00
	2,591				5.00	5.00
		2,746			2.00	1.00
		4,613			2.00	128.00
		5,520			1.00	8.00
Frame		2,591			49.00	360.00
		2,591			1.00	1.00
		3,986			2.00	2.00
Compartments/Body	2,319				2.00	6.00
	5,520				2.00	4.00
Windows		5,633			2.00	8.00
		7,108			1.00	1.00
Air Conditioning		7,153			14.00	384.00
Exhaust System		5,214			2.00	8.00

3. SAFETY - A DOUBLE-LANE CHANGE (OBSTACLE AVOIDANCE)

3-I. TEST OBJECTIVE

The objective of this test is to determine handling and stability of the bus by measuring speed through a double lane change test.

3-II. TEST DESCRIPTION

The Safety Test is a vehicle handling and stability test. The bus will be operated at SLW on a smooth and level test track. The bus will be driven through a double lane change course at increasing speed until the test is considered unsafe or a speed of 45 mph is reached. The lane change course will be set up using pylons to mark off two 12 foot center to center lanes with two 100 foot lane change areas 100 feet apart. The bus will begin in one lane, change to the other lane in a 100 foot span, travel 100 feet, and return to the original lane in another 100 foot span. This procedure will be repeated, starting first in the right-hand and then in the left-hand lane.

3-III. DISCUSSION

The double-lane change was performed in both right-hand and left-hand directions. The bus was able to safely negotiate the test course in both the right-hand and left-hand directions up to the maximum test speed of 45 mph.

SAFETY DATA FORM

Page 1 of 1

Bus Number: 1120	Date: 7-17-12
Personnel: M.R., T.S. & S.R.	

Temperature (°F): 79	Humidity (%): 54
Wind Direction: SW	Wind Speed (mph): 8
Barometric Pressure (in.Hg): 29.93	

SAFETY TEST: DOUBLE LANE CHANGE	
Maximum safe speed tested for double-lane change to left	45 mph
Maximum safe speed tested for double-lane change to right	45 mph
Comments of the position of the bus during the lane change: A safe profile was maintained through all portions of testing.	
Comments of the tire/ground contact patch: Tire/ground contact was maintained through all portions of testing.	

3. SAFETY



RIGHT - HAND APPROACH



LEFT - HAND APPROACH

4.0 PERFORMANCE

4.1 PERFORMANCE - AN ACCELERATION, GRADEABILITY, AND TOP SPEED TEST

4.1-I. TEST OBJECTIVE

The objective of this test is to determine the acceleration, gradeability, and top speed capabilities of the bus.

4.1-II. TEST DESCRIPTION

In this test, the bus will be operated at SLW on the skid pad at the PSBRTF. The bus will be accelerated at full throttle from a standstill to a maximum "geared" or "safe" speed as determined by the test driver. The vehicle speed is measured using a Correvit non-contacting speed sensor. The times to reach speed between ten mile per hour increments are measured and recorded using a stopwatch with a lap timer. The time to speed data will be recorded on the Performance Data Form and later used to generate a speed vs. time plot and gradeability calculations.

4.1-III. DISCUSSION

This test consists of three runs in both the clockwise and counterclockwise directions on the Test Track. Velocity versus time data is obtained for each run and results are averaged together to minimize any test variability which might be introduced by wind or other external factors. The test was performed up to a maximum speed of 50 mph. The fitted curve of velocity vs. time is attached, followed by the calculated gradeability results. The average time to obtain 50 mph was 16.97 seconds.

PERFORMANCE DATA FORM

Page 1 of 1

Bus Number: 1120		Date: 7-17-12	
Personnel: M.R., T.S. & S.R.			
Temperature (°F): 79		Humidity (%): 54	
Wind Direction: SW		Wind Speed (mph): 8	
Barometric Pressure (in.Hg): 29.93			
		INITIALS:	
Ventilation fans-ON HIGH	✓Checked	S.R.	
Heater pump motor-Off	✓Checked	S.R.	
Defroster-OFF	✓ Checked	S.R.	
Exterior and interior lights-ON	✓ Checked	S.R.	
Windows and doors-CLOSED	✓ Checked	S.R.	
ACCELERATION, GRADEABILITY, TOP SPEED			
Counter Clockwise Recorded Interval Times			
Speed	Run 1	Run 2	Run 3
10 mph	2.70	3.01	2.92
20 mph	5.64	5.82	5.35
30 mph	8.83	9.01	8.51
40 mph	12.83	12.42	12.35
Top Test Speed(mph) 50	17.70	17.23	17.20
Clockwise Recorded Interval Times			
Speed	Run 1	Run 2	Run 3
10 mph	2.61	2.73	2.79
20 mph	5.29	5.33	5.29
30 mph	8.04	8.14	8.14
40 mph	11.54	11.80	11.73
Top Test Speed(mph) 50	16.29	16.70	16.70

1120.ACC

PERFORMANCE SUMMARY SHEET

BUS MANUFACTURER :GLAVAL
 BUS MODEL :28' TITAN II LF
 BUS NUMBER :1120
 TEST DATE :07/17/12

TEST CONDITIONS :


 TEMPERATURE (DEG F) : 79.0
 WIND DIRECTION : SW
 WIND SPEED (MPH) : 8.0
 HUMIDITY (%) : 54
 BAROMETRIC PRESSURE (IN. HG) : 29.9

VEHICLE SPEED (MPH)	AVERAGE TIME (SEC)		
	CCW DIRECTION	CW DIRECTION	TOTAL
10.0	2.88	2.71	2.79
20.0	5.60	5.30	5.45
30.0	8.78	8.11	8.45
40.0	12.53	11.69	12.11
50.0	17.38	16.56	16.97

TEST SUMMARY :

VEHICLE SPEED (MPH)	TIME (SEC)	ACCELERATION (FT/SEC^2)	MAX. GRADE (%)
1.0	.24	6.1	19.3
5.0	1.22	5.8	18.5
10.0	2.51	5.5	17.4
15.0	3.89	5.2	16.3
20.0	5.35	4.9	15.2
25.0	6.91	4.5	14.2
30.0	8.59	4.2	13.2
35.0	10.40	3.9	12.2
40.0	12.36	3.6	11.3
45.0	14.48	3.3	10.3
50.0	16.80	3.0	9.5

NOTE : Gradeability results were calculated from performance
 ----- test data. Actual sustained gradeability performance
 for vehicles equipped with auto transmission may be
 lower than the values indicated here.

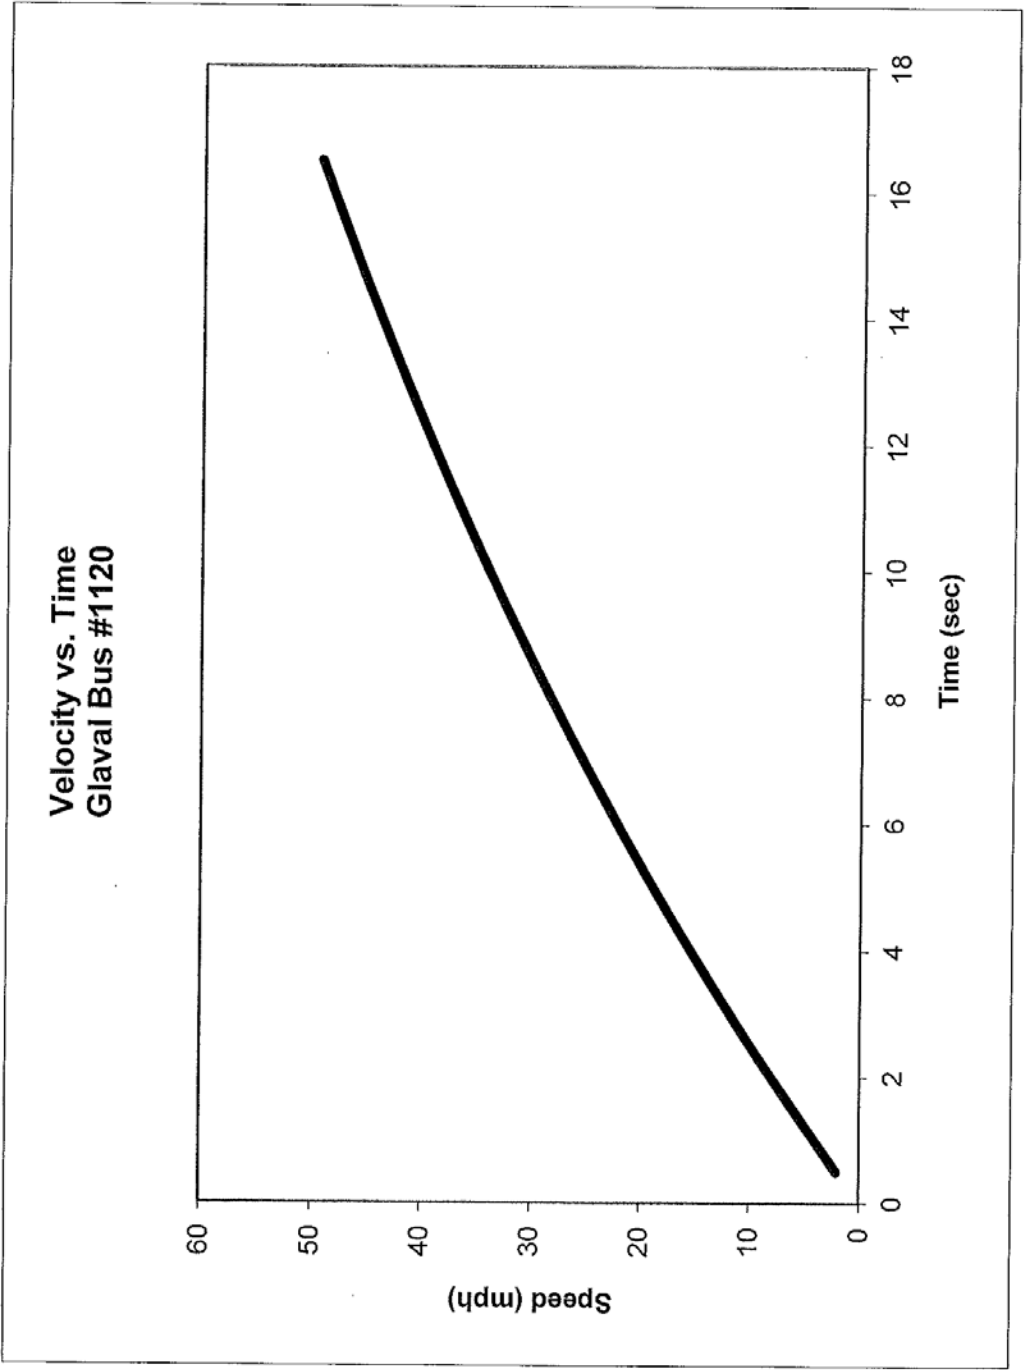

4.0 PERFORMANCE

4.2 Performance - Bus Braking

4.2 I. TEST OBJECTIVE

The objective of this test is to provide, for comparison purposes, braking performance data on transit buses produced by different manufacturers.

4.2 II. TEST DESCRIPTION

The testing will be conducted at the PTI Test Track skid pad area. Brake tests will be conducted after completion of the GVW portion of the vehicle durability test. At this point in testing the brakes have been subjected to a large number of braking snubs and will be considered well burnished. Testing will be performed when the bus is fully loaded at its GVW. All tires on each bus must be representative of the tires on the production model vehicle

The brake testing procedure comprises three phases:

1. Stopping distance tests
 - i. Dry surface (high-friction, Skid Number within the range of 70-76)
 - ii. Wet surface (low-friction, Skid Number within the range of 30-36)
2. Stability tests
3. Parking brake test

Stopping Distance Tests

The stopping distance phase will evaluate service brake stops. All stopping distance tests on dry surface will be performed in a straight line and at the speeds of 20, 30, 40 and 45 mph. All stopping distance tests on wet surface will be performed in straight line at speed of 20 mph.

The tests will be conducted as follows:

1. **Uniform High Friction Tests:** Four maximum deceleration straight-line brake applications each at 20, 30, 40 and 45 mph, to a full stop on a uniform high-friction surface in a 3.66-m (12-ft) wide lane.
2. **Uniform Low Friction Tests:** Four maximum deceleration straight-line brake applications from 20 mph on a uniform low friction surface in a 3.66-m (12-ft) wide lane.

When performing service brake stops for both cases, the test vehicle is accelerated on the bus test lane to the speed specified in the test procedure and this speed is maintained into the skid pad area. Upon entry of the appropriate lane of the skid pad area, the vehicle's service brake is applied to stop the vehicle as quickly as

possible. The stopping distance is measured and recorded for both cases on the test data form. Stopping distance results on dry and wet surfaces will be recorded and the average of the four measured stopping distances will be considered as the measured stopping distance. Any deviation from the test lane will be recorded.

Stability Tests

This test will be conducted in both directions on the test track. The test consists of four maximum deceleration, straight-line brake applications on a surface with split coefficients of friction (i.e., the wheels on one side run on high-friction SN 70-76 or more and the other side on low-friction [where the lower coefficient of friction should be less than half of the high one] at initial speed of 30 mph).

(I) The performance of the vehicle will be evaluated to determine if it is possible to keep the vehicle within a 3.66m (12 ft) wide lane, with the dividing line between the two surfaces in the lane's center. The steering wheel input angle required to keep the vehicle in the lane during the maneuver will be reported.

Parking Brake Test

The parking brake phase utilizes the brake slope, which has a 20% grade. The test vehicle, at its GVW, is driven onto the brake slope and stopped. With the transmission in neutral, the parking brake is applied and the service brake is released. The test vehicle is required to remain stationary for five minutes. The parking brake test is performed with the vehicle facing uphill and downhill.

4.2-III. DISCUSSION

The Stopping Distance phase of the Brake Test was completed with the following results; for the Uniform High Friction Test average stopping distances were 22.28' at 20 mph, 51.32' at 30 mph, 86.40' at 40 mph and 119.93' at 45 mph. The average stopping distance for the Uniform Low Friction Test was 23.62'. There was no deviation from the test lane during the performance of the Stopping Distance phase.

During the Stability phase of Brake Testing the test bus experienced no deviation from the test lane but did experience pull to the left during both approaches to the Split Friction Road surface.

The Parking Brake phase was completed with the test bus maintaining the parked position for the full five minute period with no slip or roll observed in both the uphill and downhill positions.

Table 4.2-6. Braking Test Data Forms

Page 1 of 3

Bus Number: 1120	Date: 7/19/12
Personnel: T.M., T.S. & S.R.	
Amb. Temperature (°F): 79	Wind Speed (mph): 0
Wind Direction: Calm	Pavement Temp (°F) Start: 91.2 End: 92.3

TIRE INFLATION PRESSURE (psi):				
Tire Type: Front:		Rear:		
	Left Tire(s)		Right Tire(s)	
Front	65		65	
	Inner	Outer	Inner	Outer
Rear	60	60	60	60
Rear	Not equipped	Not equipped	Not equipped	Not equipped

AXLE LOADS (lb)		
	Left	Right
Front	2,110	2,040
Rear	4,010	4,560

FINAL INSPECTION	
Bus Number: 1120	Date: 7-19-12
Personnel: T.M., T.S. & S.R.	

Table 4.2-7. Record of All Braking System Faults/Repairs.

Page 2 of 3

Date	Personnel	Fault/Repair	Description
7/19/12	T.M., T.S. & S.R.	None noted.	

Table 4.2-8.1. Stopping Distance Test Results Form

Page 3 of 3

Stopping Distance (ft)					
Vehicle Direction	CW	CW	CCW	CCW	
Speed (mph)	Stop 1	Stop 2	Stop 3	Stop 4	Average
20 (dry)	22.68	22.92	21.28	22.22	22.28
30 (dry)	49.16	50.36	48.44	57.31	51.32
40 (dry)	87.85	85.01	88.85	83.87	86.40
45 (dry)	123.52	119.62	116.80	119.77	119.93
20 (wet)	23.73	24.43	23.48	22.83	23.62

Table 4.2-8.2. Stability Test Results Form

Stability Test Results (Split Friction Road surface)		
Vehicle Direction	Attempt	Did test bus stay in 12' lane? (yes/no)
CW	1	Yes
	2	Yes
CCW	1	Yes
	2	Yes

Table 4.2-8.3. Parking Brake Test Form

PARKING BRAKE (Fully Loaded) – GRADE HOLDING						
Vehicle Direction	Attempt	Hold Time (min)	Slide (in)	Roll (in)	Did Hold	No Hold
Front up	1	5	0	0	✓	
	2					
	3					
Front down	1	5	0	0	✓	
	2					
	3					

5.1 STRUCTURAL INTEGRITY

5.1 STRUCTURAL STRENGTH AND DISTORTION TESTS – STRUCTURAL SHAKEDOWN TEST

5.1-I. DISCUSSION

The objective of this test is to determine certain static characteristics (e.g., bus floor deflection, permanent structural deformation, etc.) under static loading conditions.

5.1-II. TEST DESCRIPTION

In this test, the bus will be isolated from the suspension by blocking the vehicle under the suspension points. The bus will then be loaded and unloaded up to a maximum of three times with a distributed load equal to 2.5 times gross load. Gross load is 150 lb for every designed passenger seating position, for the driver, and for each 1.5 sq ft of free floor space. For a distributed load equal to 2.5 times gross load, place a 375-lb load on each seat and on every 1.5 sq ft of free floor space. The first loading and unloading sequence will “settle” the structure. Bus deflection will be measured at several locations during the loading sequences.

5.1-III. DISCUSSION

This test was performed based on a maximum passenger capacity of 11 people including the driver. The resulting test load is $(11 \times 375 \text{ lb}) = 4,125 \text{ lb}$. The load is distributed evenly over the passenger space. Deflection data before and after each loading and unloading sequence is provided on the Structural Shakedown Data Form.

The unloaded height after each test becomes the original height for the next test. Some initial settling is expected due to undercoat compression, etc. After each loading cycle, the deflection of each reference point is determined. The bus is then unloaded and the residual (permanent) deflection is recorded. On the final test, the maximum loaded deflection was 0.179 Inches at reference point 9. The maximum permanent deflection after the final loading sequence ranged from -0.004 Inches at reference points 3, 4, and 9 to 0.002 inches at reference points 1, 6, 7, and 12.

STRUCTURAL SHAKEDOWN DATA FORM

Page 1 of 2


Bus Number: 1120	Date: 7-16-12
Personnel: E.D., E.L., T.S. & S.R.	Temperature (°F): 77
Loading Sequence: ☒ 1 ☐ 2 ☐ 3 (check one) Test Load (lbs): 4,125	

Indicate Approximate Location of Each Reference Point

Right

Front
of
Bus

Left

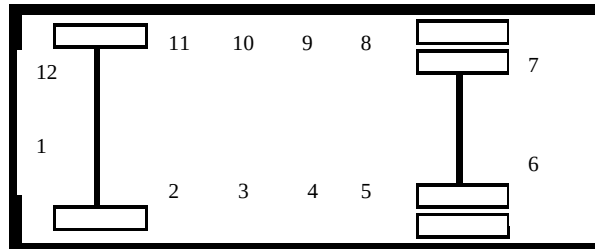

Top View

Reference Point No.	A (in) Original Height	B (in) Loaded Height	B-A (in) Loaded Deflection	C (in) Unloaded Height	C-A (in) Permanent Deflection
1	0	-.077	-.077	-.008	-.008
2	0	.073	.073	.012	.012
3	0	.108	.108	.018	.018
4	0	.139	.139	.022	.022
5	0	.142	.142	.023	.023
6	0	-.108	-.108	-.021	-.021
7	0	-.087	-.087	-.021	-.021
8	0	.205	.205	.029	.029
9	0	.209	.209	.028	.028
10	0	.168	.168	.020	.020
11	0	.087	.087	.015	.015
12	0	-.092	-.092	-.008	-.008

STRUCTURAL SHAKEDOWN DATA FORM

Page 2 of 2


Bus Number: 1120	Date: 7-16-12
Personnel: E.D., E.L., T.S. & S.R.	Temperature (°F): 79
Loading Sequence: ☐ 1 ☒ 2 ☐ 3 (check one) Test Load (lbs): 4,125	

Indicate Approximate Location of Each Reference Point

Right

Front
of
Bus

Left

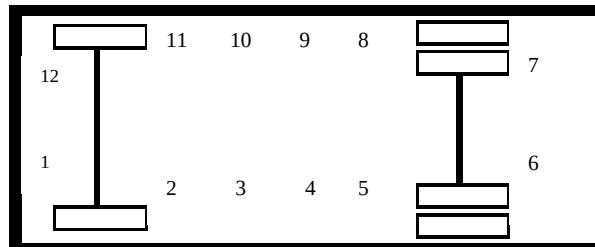

Top View

Reference Point No.	A (in) Original Height	B (in) Loaded Height	B-A (in) Loaded Deflection	C (in) Unloaded Height	C-A (in) Permanent Deflection
1	-.008	-.073	-.065	-.006	.002
2	.012	.073	.061	.009	-.003
3	.018	.107	.089	.014	-.004
4	.022	.136	.114	.018	-.004
5	.023	.139	.116	.020	-.003
6	-.021	-.097	-.076	-.019	.002
7	-.021	-.079	-.058	-.019	.002
8	.029	.201	.172	.027	-.002
9	.028	.207	.179	.024	-.004
10	.020	.169	.149	.017	-.003
11	.015	.087	.072	.012	-.003
12	-.008	-.088	-.080	-.006	.002

5.1 STRUCTURAL SHAKEDOWN TEST



DIAL INDICATORS IN POSITION



**BUS LOADED TO 2.5 TIMES GVL
(4,125 LBS)**

5.2 STRUCTURAL STRENGTH AND DISTORTION TESTS - STRUCTURAL DISTORTION

5.2-I. TEST OBJECTIVE

The objective of this test is to observe the operation of the bus subsystems when the bus is placed in a longitudinal twist simulating operation over a curb or through a pothole.

5.2-II. TEST DESCRIPTION

With the bus loaded to GVWR, each wheel of the bus will be raised (one at a time) to simulate operation over a curb and the following will be inspected:

1. Body
2. Windows
3. Doors
4. Roof vents
5. Special seating
6. Undercarriage
7. Engine
8. Service doors
9. Escape hatches
10. Steering mechanism

Each wheel will then be lowered (one at a time) to simulate operation through a pothole and the same items inspected.

5.2-III. DISCUSSION

The test sequence was repeated ten times. The first and last test is with all wheels level. The other eight tests are with each wheel 6 inches higher and 6 inches lower than the other three wheels.

All doors, windows, escape mechanisms, engine, steering and handicapped devices operated normally throughout the test. The undercarriage and body indicated no deficiencies. No water leakage was observed during the test. The results of this test are indicated on the following data forms.

DISTORTION TEST INSPECTION FORM

(Note: Ten copies of this data sheet are required)

Page 1 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☒ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM

(Note: Ten copies of this data sheet are required)

Page 2 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☒ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 3 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☒ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 4 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☒ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 5 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☒ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 6 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☒ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 7 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☒ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 8 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☒ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 9 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☐ after
Left front	☐ 6 in higher	☒ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

DISTORTION TEST INSPECTION FORM
 (Note: Ten copies of this data sheet are required)
 Page 10 of 10

Bus Number: 1120	Date: 3-21-12
Personnel: K.D., E.L., J.P. & C.J.	Temperature(°F): 61

Wheel Position : (check one)		
All wheels level	☐ before	☒ after
Left front	☐ 6 in higher	☐ 6 in lower
Right front	☐ 6 in higher	☐ 6 in lower
Right rear	☐ 6 in higher	☐ 6 in lower
Left rear	☐ 6 in higher	☐ 6 in lower

	Comments
☒ Windows	No deficiencies.
☒ Front Doors	No deficiencies.
☒ Rear Doors	No deficiencies.
☒ Escape Mechanisms/ Roof Vents	No deficiencies.
☒ Engine	No deficiencies.
☒ Handicapped Device/ Special Seating	No deficiencies.
☒ Undercarriage	No deficiencies.
☒ Service Doors	No deficiencies.
☒ Body	No deficiencies.
☒ Windows/ Body Leakage	No deficiencies.
☒ Steering Mechanism	No deficiencies.

5.2 STRUCTURAL DISTORTION TEST



RIGHT FRONT WHEEL SIX INCHES HIGHER



LEFT REAR WHEEL SIX INCHES LOWER

5.3 STRUCTURAL STRENGTH AND DISTORTION TESTS - STATIC TOWING TEST

5.3-I. TEST OBJECTIVE

The objective of this test is to determine the characteristics of the bus towing mechanisms under static loading conditions.

5.3-II. TEST DESCRIPTION

Utilizing a load-distributing yoke, a hydraulic cylinder is used to apply a static tension load equal to 1.2 times the bus curb weight. The load will be applied to both the front and rear, if applicable, towing fixtures at an angle of 20 degrees with the longitudinal axis of the bus, first to one side then the other in the horizontal plane, and then upward and downward in the vertical plane. Any permanent deformation or damage to the tow eyes or adjoining structure will be recorded.

5.3-III. DISCUSSION

The test bus submitted for testing was not equipped with any type of tow eyes or tow hooks, therefore the Static Towing Test was not performed.

5.4 STRUCTURAL STRENGTH AND DISTORTION TESTS - DYNAMIC TOWING TEST

5.4-I. TEST OBJECTIVE

The objective of this test is to verify the integrity of the towing fixtures and determine the feasibility of towing the bus under manufacturer specified procedures.

5.4-II. TEST DESCRIPTION

This test requires the bus be towed at curb weight using the specified equipment and instructions provided by the manufacturer and a heavy-duty wrecker. The bus will be towed for 5 miles at a speed of 20 mph for each recommended towing configuration. After releasing the bus from the wrecker, the bus will be visually inspected for any structural damage or permanent deformation. All doors, windows and passenger escape mechanisms will be inspected for proper operation.

5.4-III. DISCUSSION

The bus was towed using a heavy-duty wrecker. The towing interface was accomplished by incorporating a hydraulic under lift. A front lift tow was performed. Rear towing is not recommended. No problems, deformation, or damage was noted during testing.

DYNAMIC TOWING TEST DATA FORM

Page 1 of 1

Bus Number: 1120	Date: 7-25-12
Personnel: E.D., E.L. & S.R.	

Temperature (°F): 80	Humidity (%): 33
Wind Direction: WSW	Wind Speed (mph): 2
Barometric Pressure (in.Hg): 29.95	

Inspect tow equipment-bus interface.
Comments: A safe and adequate connection was made between the tow
equipment and the bus.
Inspect tow equipment-wrecker interface.
Comments: A safe and adequate connection was made between the tow
equipment and the wrecker.
Towing Comments: A front lift tow was performed incorporating a hydraulic under
lift wrecker.
Description and location of any structural damage: None noted.
General Comments: No problems with the towing interface or towing procedures
were encountered.

5.4 DYNAMIC TOWING TEST



TOWING INTERFACE



TEST BUS IN TOW

5.5 STRUCTURAL STRENGTH AND DISTORTION TESTS – JACKING TEST

5.5-I. TEST OBJECTIVE

The objective of this test is to inspect for damage due to the deflated tire, and determine the feasibility of jacking the bus with a portable hydraulic jack to a height sufficient to replace a deflated tire.

5.5-II. TEST DESCRIPTION

With the bus at curb weight, the tire(s) at one corner of the bus are replaced with deflated tire(s) of the appropriate type. A portable hydraulic floor jack is then positioned in a manner and location specified by the manufacturer and used to raise the bus to a height sufficient to provide 3-in clearance between the floor and an inflated tire. The deflated tire(s) are replaced with the original tire(s) and the jack is lowered. Any structural damage or permanent deformation is recorded on the test data sheet. This procedure is repeated for each corner of the bus.

5.5-III. DISCUSSION

The jack used for this test has a minimum height of 8.75 inches. During the deflated portion of the test, the jacking point clearances ranged from 3.1 inches to 8.0 inches. No deformation or damage was observed during testing. A complete listing of jacking point clearances is provided in the Jacking Test Data Form.

JACKING CLEARANCE SUMMARY

Condition	Frame Point Clearance
Front axle – one tire flat	7.8"
Rear axle – one tire flat	7.1"
Rear axle – two tires flat	4.6"

JACKING TEST DATA FORM

Page 1 of 1

Bus Number: 1120	Date: 1-13-12
Personnel: E.D. & E.L.	Temperature (°F): 62

Record any permanent deformation or damage to bus as well as any difficulty encountered during jacking procedure.

Deflated Tire	Jacking Pad Clearance Body/Frame (in)	Jacking Pad Clearance Axle/Suspension (in)	Comments
Right front	9.2" I 7.8" D	7.2" I 5.4" D	
Left front	9.4" I 8.0" D	7.1" I 5.3" D	
Right rear—outside	7.9" I 7.3" D	5.6" I 5.2" D	
Right rear—both	7.9" I 4.8" D	5.6" I 3.1" D	
Left rear—outside	7.6" I 7.1" D	5.7" I 5.4" D	
Left rear—both	7.6" I 4.6" D	5.7" I 3.3" D	
Right middle or tag—outside	NA	NA	
Right middle or tag—both	NA	NA	
Left middle or tag—outside	NA	NA	
Left middle or tag—both	NA	NA	
Additional comments of any deformation or difficulty during jacking:			
None noted.			

5.6 STRUCTURAL STRENGTH AND DISTORTION TESTS - HOISTING TEST

5.6-I. TEST OBJECTIVE

The objective of this test is to determine possible damage or deformation caused by the jack/stands.

5.6-II. TEST DESCRIPTION

With the bus at curb weight, the front end of the bus is raised to a height sufficient to allow manufacturer-specified placement of jack stands under the axles or jacking pads independent of the hoist system. The bus will be checked for stability on the jack stands and for any damage to the jacking pads or bulkheads. The procedure is repeated for the rear end of the bus. The procedure is then repeated for the front and rear simultaneously.

5.6-III. DISCUSSION

The test was conducted using four posts of a six-post electric lift and standard 19 inch jack stands. The bus was hoisted from the front wheel, rear wheel, and then the front and rear wheels simultaneously and placed on jack stands.

The bus easily accommodated the placement of the vehicle lifts and jack stands and the procedure was performed without any instability noted.

HOISTING TEST DATA FORM

Page 1 of 1

Bus Number: 1120	Date: 1-13-12
Personnel: E.D. & E.L.	Temperature (°F): 62

Comments of any structural damage to the jacking pads or axles while both the front wheels are supported by the jack stands:

None noted.

Comments of any structural damage to the jacking pads or axles while both the rear wheels are supported by the jack stands:

None noted.

Comments of any structural damage to the jacking pads or axles while both the front and rear wheels are supported by the jack stands:

None noted.

5.7 STRUCTURAL DURABILITY TEST

5.7-I. TEST OBJECTIVE

The objective of this test is to perform an accelerated durability test that approximates up to 25 percent of the service life of the vehicle.

5.7-II. TEST DESCRIPTION

The test vehicle is driven a total of 7,500 miles; approximately 5,000 miles on the PSBRTF Durability Test Track and approximately 2,500 miscellaneous other miles. The test will be conducted with the bus operated under three different loading conditions. The first segment will consist of approximately 3,000 miles with the bus operated at GVW. The second segment will consist of approximately 1,500 miles with the bus operated at SLW. The remainder of the test, approximately 3,000 miles, will be conducted with the bus loaded to CW. If GVW exceeds the axle design weights, then the load will be adjusted to the axle design weights and the change will be recorded. All subsystems are run during these tests in their normal operating modes. All recommended manufacturers servicing is to be followed and noted on the vehicle maintainability log. Servicing items accelerated by the durability tests will be compressed by 10:1; all others will be done on a 1:1 mi/mi basis. Unscheduled breakdowns and repairs are recorded on the same log as are any unusual occurrences as noted by the driver. Once a week the test vehicle shall be washed down and thoroughly inspected for any signs of failure.

5.7-III. DISCUSSION

The Structural Durability Test was started on January 18, 2012 and was conducted until June 6, 2012. **(Note: this test bus is not designed for standing passengers; therefore GVW and SLW are the same 12,720 lbs.).** The first 3,000 miles were performed at a GVW of 12,720 lbs. and completed on April 6, 2012. The next 1,500 mile SLW segment was performed at the same 12,720 lbs and completed on May 4, 2012, and the final 3,000 mile segment was performed at a CW of 11,100 lbs and completed on June 6, 2012.

The following mileage summary presents the accumulation of miles during the Structural Durability Test. The driving schedule is included, showing the operating duty cycle. A detailed plan view of the Test Track Facility and Durability Test Track are attached for reference. Also, a durability element profile detail shows all the measurements of the different conditions. Finally, photographs illustrating some of the failures that were encountered during the Structural Durability Test are included.

GLAVAL BUS #1120
MILEAGE DRIVEN/RECORDED FROM DRIVER'S LOGS

DATE	TOTAL DURABILITY TRACK	TOTAL OTHER MILES	TOTAL
03/19/12 TO 03/25/12	182.00	9.00	191.00
03/26/12 TO 04/01/12	1000.00	92.00	1092.00
04/02/12 TO 04/08/12	867.00	75.00	942.00
04/09/12 TO 04/15/12	338.00	28.00	366.00
04/16/12 TO 04/22/12	0.00	0.00	0.00
04/23/12 TO 04/29/12	0.00	0.00	0.00
04/30/12 TO 05/06/12	669.00	121.00	790.00
05/07/12 TO 05/13/12	807.00	428.00	1235.00
05/14/12 TO 05/20/12	0.00	0.00	0.00
05/21/12 TO 05/27/12	699.00	56.00	755.00
05/28/12 TO 06/03/12	438.00	421.00	859.00
06/04/12 TO 06/10/12	0.00	926.00	926.00
06/11/12 TO 06/17/12	0.00	0.00	0.00
06/18/12 TO 06/24/12	0.00	0.00	0.00
06/25/12 TO 07/01/12	0.00	0.00	0.00
07/02/12 TO 07/08/12	0.00	0.00	0.00
07/09/12 TO 07/15/12	0.00	0.00	0.00
07/16/12 TO 07/22/12	0.00	158.00	158.00
07/23/12 TO 07/29/12	0.00	78.00	78.00
07/30/12 TO 08/05/12	0.00	117.00	117.00
TOTAL	5000.00	2509.00	7509.00

Table 4. Driving Schedule for Bus Operation on the Durability Test Track.

STANDARD OPERATING SCHEDULE

Monday through Friday		
	HOUR	ACTION
Shift 1	midnight	D
	1:40 am	C
	1:50 am	B
	2:00 am	D
	3:35 am	C
	3:45 am	B
	4:05 am	D
	5:40 am	C
	5:50 am	B
	6:00 am	D
	7:40 am	C
	7:50 am	F
Shift 2	8:00 am	D
	9:40 am	C
	9:50 am	B
	10:00 am	D
	11:35 am	C
	11:45 am	B
	12:05 pm	D
	1:40 pm	C
	1:50 pm	B
	2:00 pm	D
	3:40 pm	C
	3:50 pm	F
Shift 3	4:00 pm	D
	5:40 pm	C
	5:50 pm	B
	6:00 pm	D
	7:40 pm	C
	7:50 pm	B
	8:05 pm	D
	9:40 pm	C
	9:50 pm	B
	10:00 pm	D
	11:40 pm	C
	11:50 pm	F


B—Break

C—Cycle all systems five times, visual inspection, driver's log entries

D—Drive bus as specified by procedure


F—Fuel bus, complete driver's log shift entries

“PLAN VIEW OF PENN STATE BUS TESTING AND RESEARCH FACILITY”

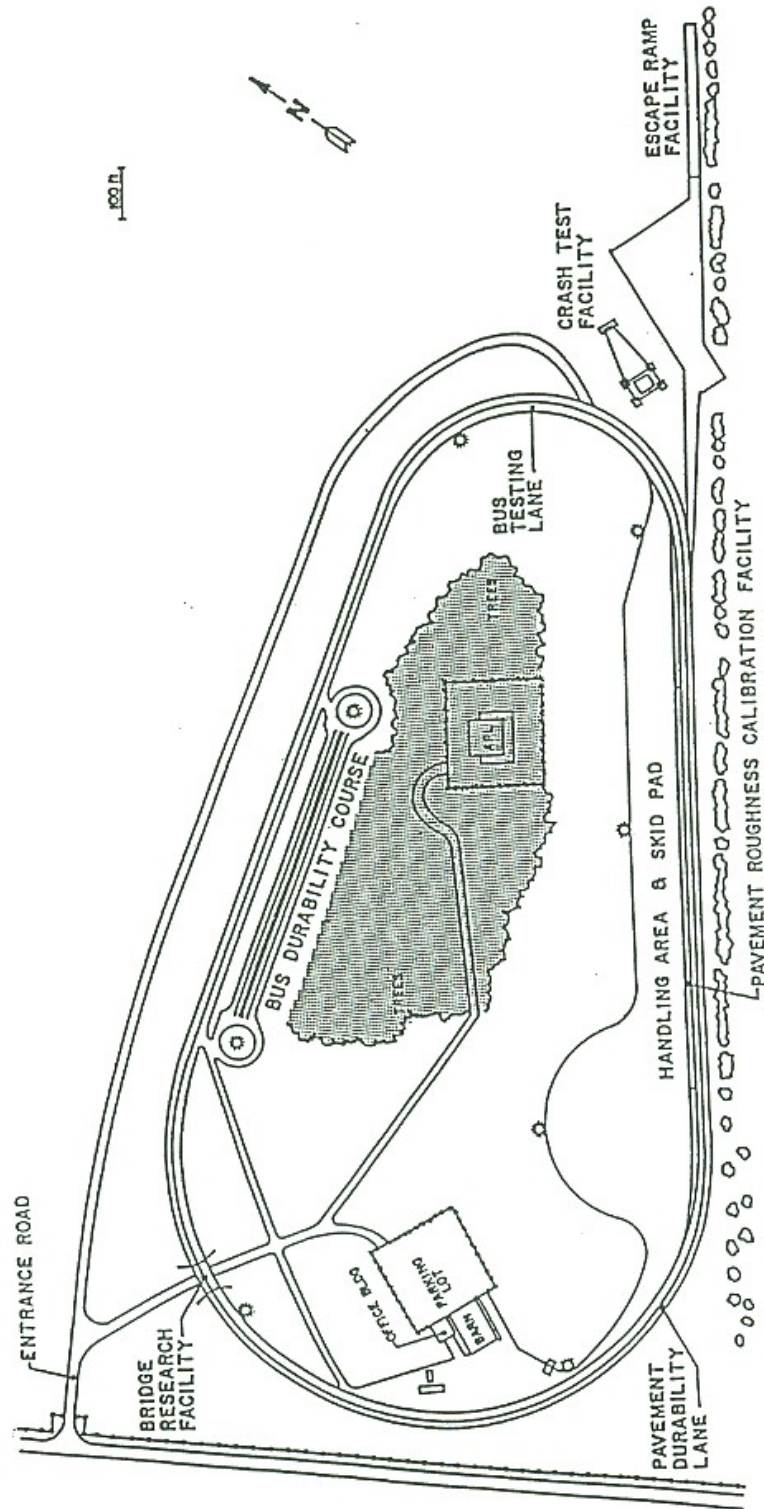


**BUS TESTING AND RESEARCH TEST TRACK
UNIVERSITY PARK, PA**

Staggered
Bumps
(10 mph)

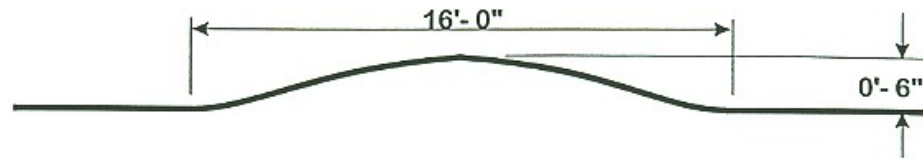


Railroad
Crossing
(8 mph)

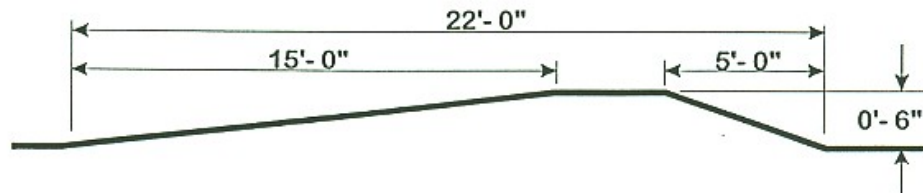


1" Random
Chuck Holes
(20 mph)




Chatter Bumps
(20 mph)

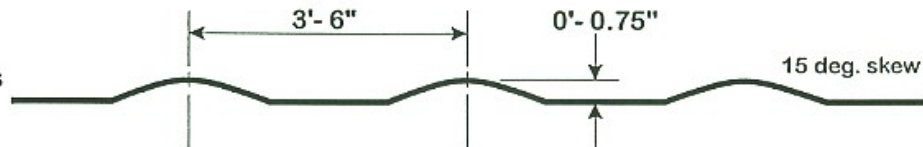


4" Chuck Hole
(5 mph)

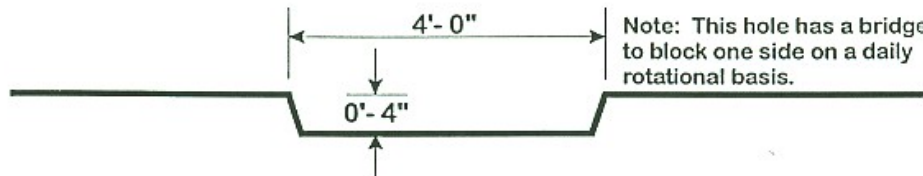

High Crown
Intersection
(20 mph)

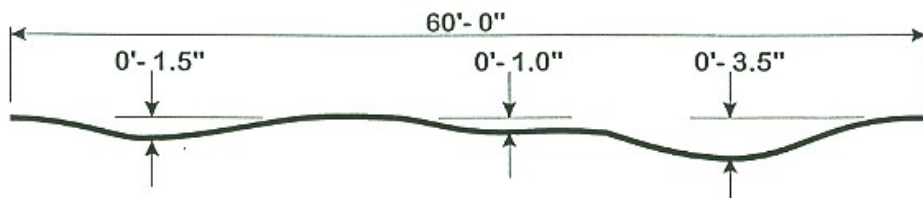

Frame Twist
(10 mph)

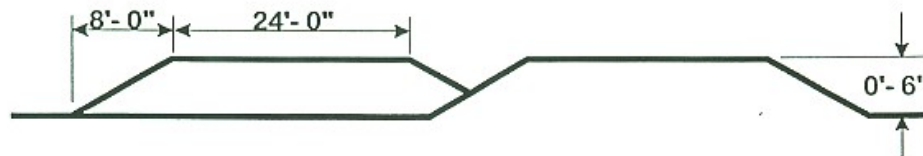

Durability Element Profiles

The Pennsylvania Transportation Institute
Penn State


(Page 1 of 2)
UNSCHEDULED MAINTENANCE
 Glaval Bus #1120

DATE	TEST MILES	SERVICE	ACTIVITY	MAN HOURS	DOWN TIME
03-22-12	31	The left side front sway bar clamp is missing a mounting bolt.	Replaced clamps and bolts on both side of the front sway bar.	1.00	1.00
03-23-12	75	The left side front sway bar clamp is broken at the lower mounting bolt.	Replaced broken clamp and bolts.	2.00	18.00
04-09-12	2,319	The engine compartment battery tray is broken at the lower attaching bolt.	Replaced battery tray.	2.00	6.00
04-10-12 to 05-01-12	2,591	Both left and right frame rails are cracked through above the rear axle.	Welding/repairs made according to manufacturer's specs. Repositioned and secured aft ends of frame rails. Cleaned and prepared cracks for welding. Access through floor acquired for proper welding of upper rails. Removed original Huck fasteners. Installed flanges over cracked area. Modified upper shock mounting brackets. Installed stanchions in both inner rails.	49.00	360.00
05-01-12	2,591	The front OEM frame cross-member is cracked at the left side.	Welded/repaired crack.	1.00	1.00
05-01-12	2,591	The front sway bar links are worn causing the sway bar to chaff front air bags.	Replaced both front air bags and both front sway bar links.	5.00	5.00


(Page 2 of 2)
UNSCHEDULED MAINTENANCE
 Glaval Bus #1120

DATE	TEST MILES	SERVICE	ACTIVITY	MAN HOURS	DOWN TIME
05-02-12	2,746	The right front sway bar clamp is missing a bolt and the clamp is bent.	Replaced right front sway bar clamp.	2.00	1.00
05-09-12	3,986	The first cross-member (ahead of the radiator) is cracked on the right side.	Removed front bumper, welded/repared cross-member and reinstalled bumper.	2.00	2.00
05-21-12	4,613	The right rear sway bar link and link bracket are broken.	Replaced right rear sway bar link and link bracket.	2.00	128.00
05-24-12	5,214	The muffler and exhaust tailpipe are broken.	Welded/repared muffler and tailpipe.	2.00	8.00
05-30-12	5,520	The right side sway bar clamp is broken on the front sway bar.	Replaced right side sway bar clamp.	1.00	8.00
05-30-12	5,520	The left bumper mounting bracket on the front bumper is broken.	Welded/repared left front bumper mounting bracket.	2.00	4.00
05-31-12	5,633	The glass in the rear panel of the passenger entrance door is broken.	Installed plexiglass. Ordered new door panel.	2.00	8.00
06-06-12	7,108	The left passenger door glass is broken.	Replaced door panel.	1.00	1.00
06-29-12	7,153	The rear A/C unit is inoperative. The evaporator line is cracked at the front of the unit.	Warranty dealer (Carrier) repaired the cracked line and recharged system.	14.00	384.00

UNSCHEDULED MAINTENANCE

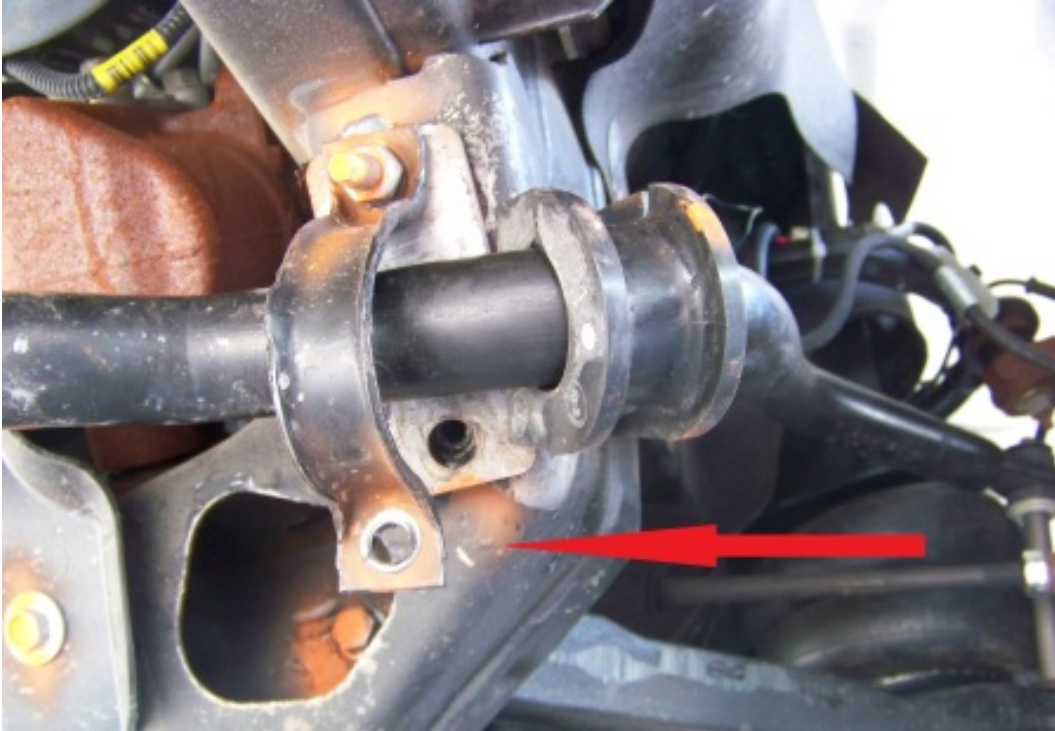

**BOLT MISSING ON FRONT, LEFT SWAY BAR CLAMP
(31 TEST MILES)**

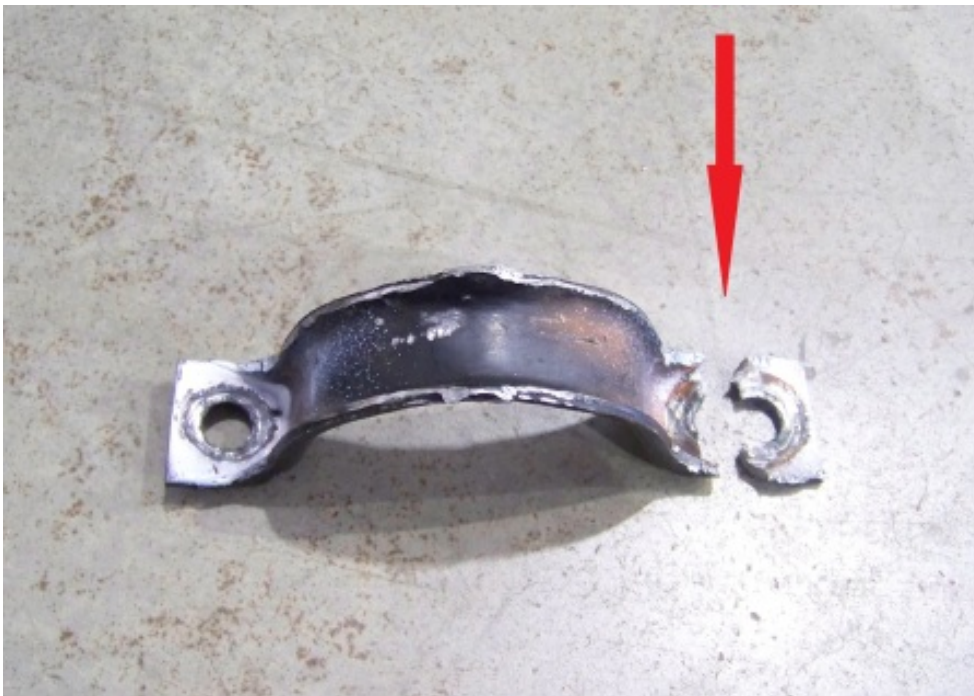


**BROKEN LEFT FRONT SWAY BAR CLAMP
(75 TEST MILES)**

UNSCHEDULED MAINTENANCE CONT.




**BROKEN BATTERY TRAY
(2,319 TEST MILES)**

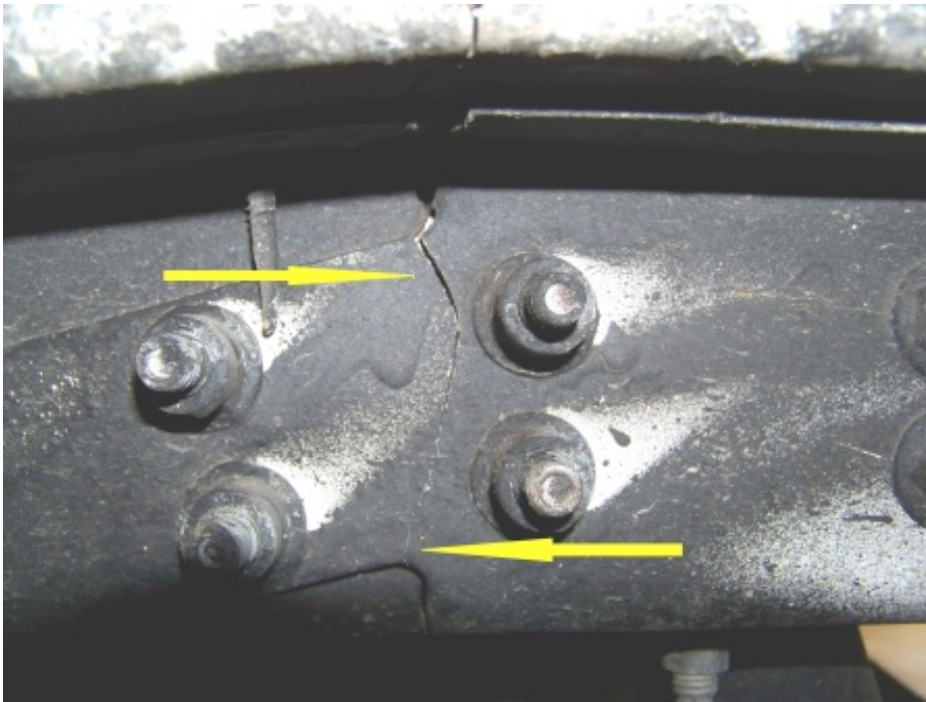


**CRACKED LEFT SIDE FRAME RAIL
(2,591 TEST MILES)**

UNSCHEDULED MAINTENANCE CONT.

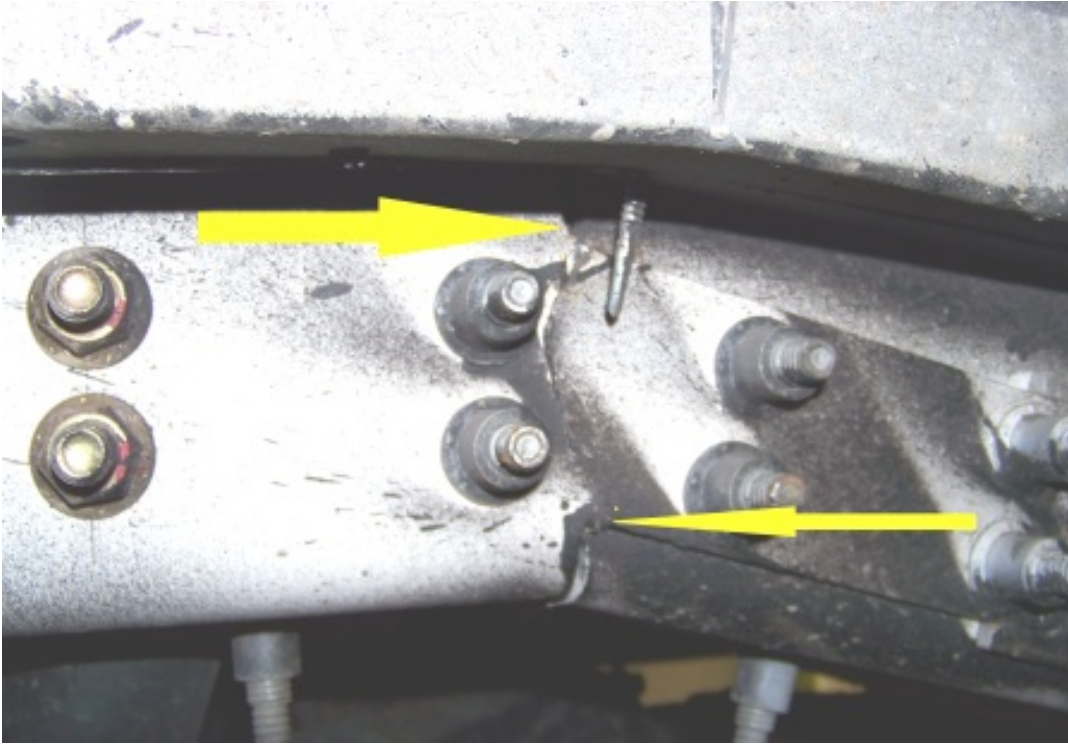


**CRACKED RIGHT SIDE FRAME RAIL
(2,591 TEST MILES)**

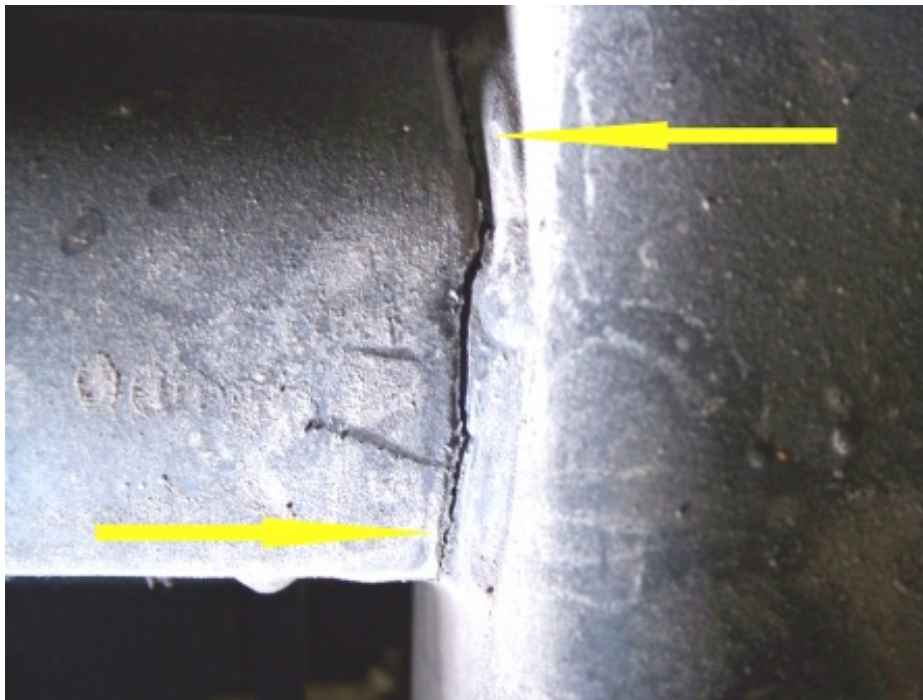


**FRONT OEM CROSS-MEMBER CRACKED
(2,591 TEST MILES)**

UNSCHEDULED MAINTENANCE CONT.

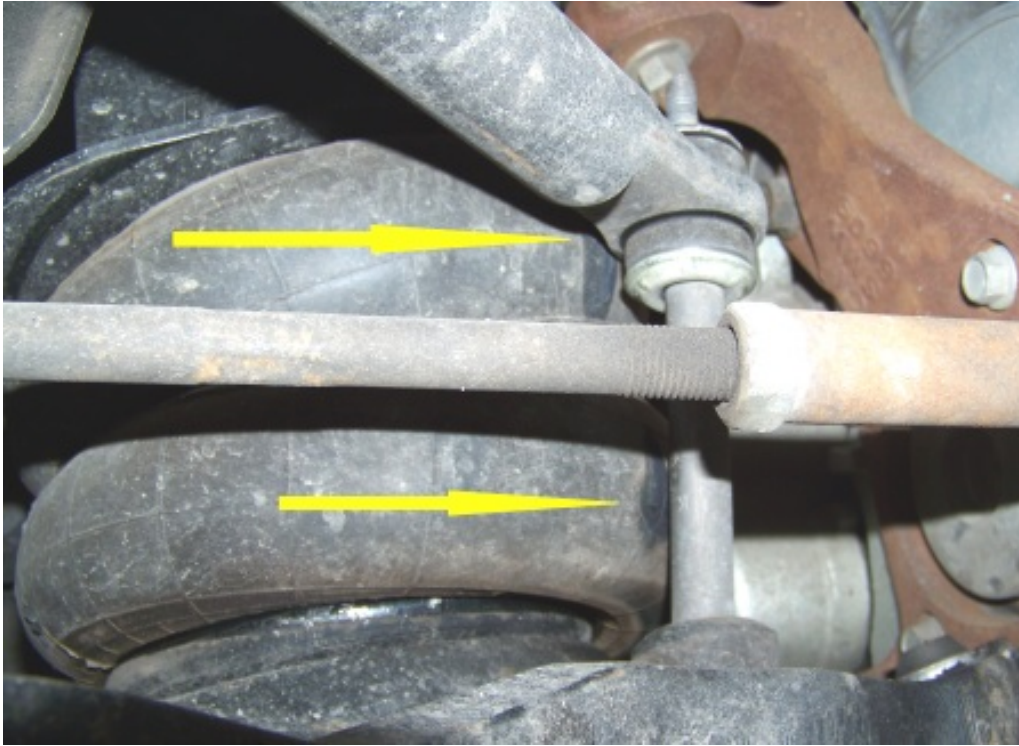

**FRONT SWAY BAR LINK CHAFFING AIR BAG
(2,591 TEST MILES)**

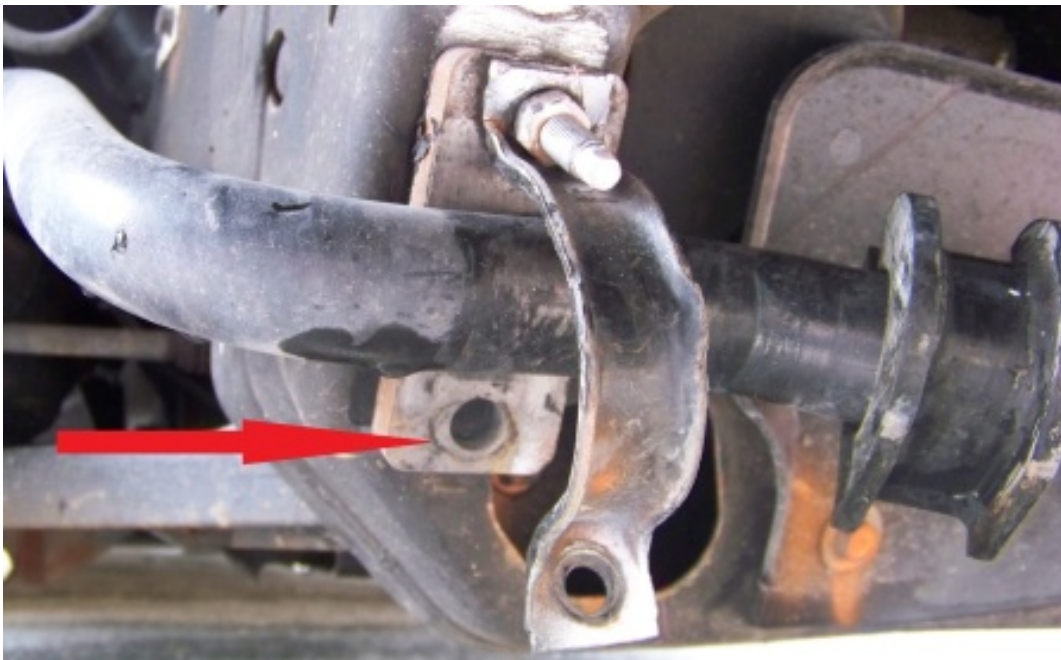

**MISSING BOLT AT RIGHT FRONT SWAY BAR CLAMP
(2,746 TEST MILES)**

UNSCHEDULED MAINTENANCE CONT.



**FRONT CROSS-MEMBER RIGHT SIDE
(3,986 TEST MILES)**



**BROKEN RIGHT REAR SWAY BAR LINK
(4,613 TEST MILES)**

UNSCHEDULED MAINTENANCE CONT.



**BROKEN LEFT, FRONT,
BUMPER MOUNTING BRACKET
(5,520 TEST MILES)**

6. FUEL ECONOMY TEST - A FUEL CONSUMPTION TEST USING AN APPROPRIATE OPERATING CYCLE

6-I. TEST OBJECTIVE

The objective of this test is to provide accurate comparable fuel consumption data on transit buses produced by different manufacturers. This fuel economy test bears no relation to the calculations done by the Environmental Protection Agency (EPA) to determine levels for the Corporate Average Fuel Economy Program. EPA's calculations are based on tests conducted under laboratory conditions intended to simulate city and highway driving. This fuel economy test, as designated here, is a measurement of the fuel expended by a vehicle traveling a specified test loop under specified operating conditions. The results of this test will not represent actual mileage but will provide data that can be used by recipients to compare buses tested by this procedure.

6-II. TEST DESCRIPTION

This test requires operation of the bus over a course based on the Transit Coach Operating Duty Cycle (ADB Cycle) at seated load weight using a procedure based on the Fuel Economy Measurement Test (Engineering Type) For Trucks and Buses: SAE 1376 July 82. The procedure has been modified by elimination of the control vehicle and by modifications as described below. The inherent uncertainty and expense of utilizing a control vehicle over the operating life of the facility is impractical.

The fuel economy test will be performed as soon as possible (weather permitting) after the completion of the GVW portion of the structural durability test. It will be conducted on the bus test lane at the Penn State Test Facility. Signs are erected at carefully measured points which delineate the test course. A test run will comprise 3 CBD phases, 2 Arterial phases, and 1 Commuter phase. An electronic fuel measuring system will indicate the amount of fuel consumed during each phase of the test. The test runs will be repeated until there are at least two runs in both the clockwise and counterclockwise directions in which the fuel consumed for each run is within ± 4 percent of the average total fuel used over the 4 runs. A 20-minute idle consumption test is performed just prior to and immediately after the driven portion of the fuel economy test. The amount of fuel consumed while operating at normal/low idle is recorded on the Fuel Economy Data Form. This set of four valid runs along with idle consumption data comprise a valid test.

The test procedure is the ADB cycle with the following four modifications:

1. The ADB cycle is structured as a set number of miles in a fixed time in the following order: CBD, Arterial, CBD, Arterial, CBD, and Commuter. A separate idle fuel consumption measurement is performed at the beginning and end of the fuel economy test. This phase sequence permits the reporting of fuel consumption for each of these phases separately, making the data more useful to bus manufacturers and transit properties.
2. The operating profile for testing purposes shall consist of simulated transit type service at seated load weight. The three test phases (figure 6-1) are: a central business district (CBD) phase of 2 miles with 7 stops per mile and a top speed of 20 mph; an arterial phase of 2 miles with 2 stops per mile and a top speed of 40 mph; and a commuter phase of 4 miles with 1 stop and a maximum speed of 40 mph. At each designated stop the bus will remain stationary for seven seconds. During this time, the passenger doors shall be opened and closed.
3. The individual ADB phases remain unaltered with the exception that 1 mile has been changed to 1 lap on the Penn State Test Track. One lap is equal to 5,042 feet. This change is accommodated by adjusting the cruise distance and time.
4. The acceleration profile, for practical purposes and to achieve better repeatability, has been changed to "full throttle acceleration to cruise speed".

Several changes were made to the Fuel Economy Measurement Test (Engineering Type) For Trucks and Buses: SAE 1376 July 82:

1. Sections 1.1, and 1.2 only apply to diesel, gasoline, methanol, and any other fuel in the liquid state (excluding cryogenic fuels).

1.1 SAE 1376 July 82 requires the use of at least a 16-gal fuel tank. Such a fuel tank when full would weigh approximately 160 lb. It is judged that a 12-gal tank weighing approximately 120 lb will be sufficient for this test and much easier for the technician and test personnel to handle.

1.2 SAE 1376 July 82 mentions the use of a mechanical scale or a flowmeter system. This test procedure uses a load cell readout combination that provides an accuracy of 0.5 percent in weight and permits on-board weighing of the gravimetric tanks at the end of each phase. This modification permits the determination of a fuel economy value for each phase as well as the overall cycle.

2. Section 2.1 applies to compressed natural gas (CNG), liquefied natural gas (LNG), cryogenic fuels, and other fuels in the vapor state.

2.1 A laminar type flowmeter will be used to determine the fuel consumption. The pressure and temperature across the flow element will be monitored by the flow computer. The flow computer will use this data to calculate the gas flow rate. The flow computer will also display the flow rate (scfm) as well as the total fuel used (scf). The total fuel used (scf) for each phase will be recorded on the Fuel Economy Data Form.

3. Use both Sections 1 and 2 for dual fuel systems.

FUEL ECONOMY CALCULATION PROCEDURE

A. For diesel, gasoline, methanol and fuels in the liquid state.

The reported fuel economy is based on the following: measured test quantities-- distance traveled (miles) and fuel consumed (pounds); standard reference values-- density of water at 60EF (8.3373 lbs/gal) and volumetric heating value of standard fuel; and test fuel specific gravity (unitless) and volumetric heating value (BTU/gal). These combine to give a fuel economy in miles per gallon (mpg) which is corrected to a standard gallon of fuel referenced to water at 60EF. This eliminates fluctuations in fuel economy due to fluctuations in fuel quality. This calculation has been programmed into a computer and the data processing is performed automatically.

The fuel economy correction consists of three steps:

- 1.) Divide the number of miles of the phase by the number of pounds of fuel consumed

<u>phase</u>	<u>miles per phase</u>	<u>total miles per run</u>
CBD	1.9097	5.7291
ART	1.9097	3.8193
COM	3.8193	3.8193

$$FE_{o_{mi/lb}} = \text{Observed fuel economy} = \frac{\text{miles}}{\text{lb of fuel}}$$

- 2.) Convert the observed fuel economy to miles per gallon [mpg] by multiplying by the specific gravity of the test fuel G_s (referred to water) at 60°F and multiply by the density of water at 60°F

$$FE_{o_{mpg}} = FE_{c_{mi/lb}} \times G_s \times G_w$$

where G_s = Specific gravity of test fuel at 60°F (referred to water)
 G_w = 8.3373 lb/gal

- 3.) Correct to a standard gallon of fuel by dividing by the volumetric heating value of the test fuel (H) and multiplying by the volumetric heating value of standard reference fuel (Q). Both heating values must have the same units.

$$FE_c = FE_{o_{mpg}} \times \frac{Q}{H}$$

where

H = Volumetric heating value of test fuel [BTU/gal]
 Q = Volumetric heating value of standard reference fuel

Combining steps 1-3 yields

$$\Rightarrow FE_c = \frac{\text{miles}}{\text{lbs}} \times (G_s \times G_w) \times \frac{Q}{H}$$

- 4.) Covert the fuel economy from mpg to an energy equivalent of miles per BTU. Since the number would be extremely small in magnitude, the energy equivalent will be represented as miles/BTU $\times 10^6$.

Eq = Energy equivalent of converting mpg to mile/BTU $\times 10^6$.

$$Eq = ((mpg)/(H)) \times 10^6$$

B. CNG, LNG, cryogenic and other fuels in the vapor state.

The reported fuel economy is based on the following: measured test quantities-- distance traveled (miles) and fuel consumed (scf); density of test fuel, and volumetric heating value (BTU/lb) of test fuel at standard conditions ($P=14.73$ psia and $T=60^\circ\text{F}$). These combine to give a fuel economy in miles per lb. The energy equivalent

(mile/BTUx10⁶) will also be provided so that the results can be compared to buses that use other fuels.

- 1.) Divide the number of miles of the phase by the number of standard cubic feet (scf) of fuel consumed.

phase	miles per phase	total miles per run
CBD	1.9097	5.7291
ART	1.9097	3.8193
COM	3.8193	3.8193

$$\text{FEO}_{\text{mi/scf}} = \text{Observed fuel economy} = \frac{\text{miles}}{\text{scf of fuel}}$$

- 2.) Convert the observed fuel economy to miles per lb by dividing FEO by the density of the test fuel at standard conditions (Lb/ft³).

Note: The density of test fuel must be determined at standard conditions as described above. If the density is not defined at the above standard conditions, then a correction will be needed before the fuel economy can be calculated.

$$\text{FEO}_{\text{mi/lb}} = \text{FEO} / G_m$$

where G_m = Density of test fuel at standard conditions

- 3.) Convert the observed fuel economy (FEOmi/lb) to an energy equivalent of (miles/BTUx10⁶) by dividing the observed fuel economy (FEOmi/lb) by the heating value of the test fuel at standard conditions.

$$\text{Eq} = ((\text{FEO}_{\text{mi/lb}})/H) \times 10^6$$

where

Eq = Energy equivalent of miles/lb to mile/BTUx10⁶

H = Volumetric heating value of test fuel at standard conditions

6-III. DISCUSSION

This is a comparative test of fuel economy using CNG fuel with a heating value of 1,008.1 btu/lb. The driving cycle consists of Central Business District (CBD), Arterial (ART), and Commuter (COM) phases as described in 6-II. The fuel consumption for each driving cycle and for idle is measured separately. The results are corrected to a reference fuel with a volumetric heating value of 126,700.0 btu/gal.

An extensive pretest maintenance check is made including the replacement of all lubrication fluids. The details of the pretest maintenance are given in the first three Pretest Maintenance Forms. The fourth sheet shows the Pretest Inspection. The next sheet shows the correction calculation for the test fuel. The next four Fuel Economy Forms provide the data from the four test runs. Finally, the summary sheet provides the average fuel consumption. The overall average is based on total fuel and total mileage for each phase. The overall average fuel consumption values were; CBD – 1.86 m/lb, ART – 2.48 m/lb, and COM – 4.01 m/lb. Average fuel consumption at idle was 5.36 lb/hr.

FUEL ECONOMY PRE-TEST MAINTENANCE FORM

Page 1 of 3

Bus Number: 1120	Date: 7-31-12	SLW (lbs): 12,720
Personnel: E.D. & E.L.		

FUEL SYSTEM	OK	Date	Initials
Install fuel measurement system	✓	7/31/12	E.D.
Replace fuel filter	✓	7/31/12	E.D.
Check for fuel leaks	✓	7/31/12	E.D.
Specify fuel type (refer to fuel analysis)	CNG		
Remarks: None noted.			
BRAKES/TIRES	OK	Date	Initials
Inspect hoses	✓	7/31/12	E.L.
Inspect brakes	✓	7/31/12	E.L.
Relube wheel bearings	✓	7/31/12	E.L.
Check tire inflation pressures (mfg. specs.)	✓	7/31/12	E.L.
Remarks: None noted.			
COOLING SYSTEM	OK	Date	Initials
Check hoses and connections	✓	7/31/12	E.D.
Check system for coolant leaks	✓	7/31/12	E.D.
Remarks: None noted.			

FUEL ECONOMY PRE-TEST MAINTENANCE FORM

Page 2 of 3

Bus Number: 1120	Date: 7-31-12		
Personnel: E.D. & E.L.			
ELECTRICAL SYSTEMS	OK	Date	Initials
Check battery	✓	7/31/12	E.L.
Inspect wiring	✓	7/31/12	E.L.
Inspect terminals	✓	7/31/12	E.L.
Check lighting	✓	7/31/12	E.L.
Remarks: None noted.			
DRIVE SYSTEM	OK	Date	Initials
Drain transmission fluid	✓	7/31/12	E.D.
Replace filter/gasket	✓	7/31/12	E.D.
Check hoses and connections	✓	7/31/12	E.D.
Replace transmission fluid	✓	7/31/12	E.D.
Check for fluid leaks	✓	7/31/12	E.D.
Remarks: None noted.			
LUBRICATION	OK	Date	Initials
Drain crankcase oil	✓	7/31/12	E.L.
Replace filters	✓	7/31/12	E.L.
Replace crankcase oil	✓	7/31/12	E.L.
Check for oil leaks	✓	7/31/12	E.L.
Check oil level	✓	7/31/12	E.L.
Lube all chassis grease fittings	✓	7/31/12	E.L.
Lube universal joints	✓	7/31/12	E.L.
Replace differential lube including axles	✓	7/31/12	E.L.
Remarks: None noted.			

FUEL ECONOMY PRE-TEST MAINTENANCE FORM

Page 3 of 3

Bus Number: 1120	Date: 7-31-12		
Personnel: E.D. & E.L.			
EXHAUST/EMISSION SYSTEM	OK	Date	Initials
Check for exhaust leaks	✓	7/31/12	E.D.
Remarks: None noted.			
ENGINE	OK	Date	Initials
Replace air filter	✓	7/31/12	E.D.
Inspect air compressor and air system	✓	7/31/12	E.D.
Inspect vacuum system, if applicable	✓	7/31/12	E.D.
Check and adjust all drive belts	✓	7/31/12	E.D.
Check cold start assist, if applicable	✓	7/31/12	E.D.
Remarks: None noted.			
STEERING SYSTEM	OK	Date	Initials
Check power steering hoses and connectors	✓	7/31/12	E.L.
Service fluid level	✓	7/31/12	E.L.
Check power steering operation	✓	7/31/12	E.L.
Remarks: None noted.			
	OK	Date	Initials
Ballast bus to seated load weight	✓	7/31/12	E.D.
TEST DRIVE	OK	Date	Initials
Check brake operation	✓	7/31/12	E.D.
Check transmission operation	✓	7/31/12	E.D.
Remarks: None noted.			

FUEL ECONOMY PRE-TEST INSPECTION FORM

Page 1 of 1

Bus Number: 1120	Date: 8-1-12
Personnel: B.L. & E.D.	
PRE WARM-UP	If OK, Initial
Fuel Economy Pre-Test Maintenance Form is complete	E.D.
Cold tire pressure (psi): Front <u>65</u> Middle <u>N/A</u> Rear <u>60</u>	E.D.
Tire wear:	E.D.
Engine oil level	E.D.
Engine coolant level	E.D.
Interior and exterior lights on, evaporator fan on	B.L.
Fuel economy instrumentation installed and working properly.	B.L.
Fuel line -- no leaks or kinks	B.L.
Speed measuring system installed on bus. Speed indicator installed in front of bus and accessible to TECH and Driver.	B.L.
Bus is loaded to SLW	E.D.
WARM-UP	If OK, Initial
Bus driven for at least one hour warm-up	B.L.
No extensive or black smoke from exhaust	B.L.
POST WARM-UP	If OK, Initial
Warm tire pressure (psi): Front <u>68</u> Middle <u>N/A</u> Rear <u>62</u>	B.L.
Environmental conditions Average wind speed <12 mph and maximum gusts <15 mph Ambient temperature between 30°F(-1C°) and 90°F(32°C) Track surface is dry Track is free of extraneous material and clear of interfering traffic	B.L.

FUEL ECONOMY DATA FORM (Gaseous Fuels)

Bus Number: 1120		Manufacturer: Glaval		Date: 8-1-12	
Run Number: 1		Personnel: E.D., B.L. & M.S.			
Test Direction: ☐ CW or ☒ CCW		Ambient Temperature (°F): 79		Humidity (%): 61	
SLW (lbs): 12,720		Wind Speed (mph) & Direction: Calm		Barometric Pressure (in.Hg): 28.89	
Cycle Type	Run Time (min:sec)		Cycle Time (min:sec)	Fuel Temperature (°F)	Total Fuel Used (SCF)
	Start	Finish			
CBD #1	0	8:26	8:26	84	23
ART #1	0	4:04	4:04	82	19
CBD #2	0	8:29	8:29	78	24
ART #2	0	4:03	4:03	79	19
CBD #3	0	8:37	8:37	77	25
COMMUTER	0	6:02	6:02	80	24
Total Fuel: 134 SCF					
20 minute idle : Total Fuel Used = 40 SCF					
No Load Flow Rate at Idle = 2.07 SCFM			No Load Flow Rate at Full Throttle = 3.78 SCFM		
Heating Value = 1,008.1 BTU/LB					
Comments: None noted.					

FUEL ECONOMY DATA FORM (Gaseous Fuels)

Bus Number: 1120		Manufacturer: Glaval		Date: 8-1-12	
Run Number: 2		Personnel: E.D., B.L. & M.S.			
Test Direction: ☒ CW or ☐ CCW		Ambient Temperature (°F): 80		Humidity (%): 62	
SLW (lbs): 12,720		Wind Speed (mph) & Direction: Calm		Barometric Pressure (in.Hg): 29.91	
Cycle Type	Run Time (min:sec)		Cycle Time (min:sec)	Fuel Temperature (°F)	Total Fuel Used (SCF)
	Start	Finish			
CBD #1	0	8:49	8:49	81	25
ART #1	0	4:07	4:07	84	19
CBD #2	0	8:53	8:53	81	26
ART #2	0	4:09	4:09	82	19
CBD #3	0	9:00	9:00	81	27
COMMUTER	0	6:00	6:00	84	25
Total Fuel: 141 SCF					
20 minute idle : Total Fuel Used = N/A SCF					
No Load Flow Rate at Idle = N/A SCFM			No Load Flow Rate at Full Throttle = N/A SCFM		
Heating Value = 1,008.1 BTU/LB					
Comments: None noted.					

FUEL ECONOMY DATA FORM (Gaseous Fuels)

Bus Number: 1120		Manufacturer: Glaval		Date: 8-1-12	
Run Number: 3		Personnel: E.D., B.L. M.S.			
Test Direction: ☐ CW or ☒ CCW		Ambient Temperature (°F): 81		Humidity (%): 62	
SLW (lbs): 12,720		Wind Speed (mph) & Direction: Calm		Barometric Pressure (in.Hg): 29.89	
Cycle Type	Run Time (min:sec)		Cycle Time (min:sec)	Fuel Temperature (°F)	Total Fuel Used (SCF)
	Start	Finish			
CBD #1	0	8:55	8:55	83	25
ART #1	0	4:03	4:03	85	19
CBD #2	0	8:54	8:54	84	24
ART #2	0	4:05	4:05	86	19
CBD #3	0	9:03	9:03	85	27
COMPUTER	0	5:59	5:59	87	23
Total Fuel: 137 SCF					
20 minute idle : Total Fuel Used = N/A SCF					
No Load Flow Rate at Idle = N/A SCFM			No Load Flow Rate at Full Throttle = N/A SCFM		
Heating Value = 1,008.1 BTU/LB					
Comments: None noted.					

FUEL ECONOMY DATA FORM (Gaseous Fuels)

Bus Number: 1120	Manufacturer: Glaval		Date: 8-1-12		
Run Number: 4	Personnel: E.D., B.L. & M.S.				
Test Direction: ☒ CW or ☐ CCW	Ambient Temperature (°F): 82	Humidity (%): 58			
SLW (lbs): 12,720	Wind Speed (mph) & Direction: 3.5 / W	Barometric Pressure (in.Hg): 29.91			
Cycle Type	Run Time (min:sec)		Cycle Time (min:sec)	Fuel Temperature (°F)	Total Fuel Used (SCF)
	Start	Finish			
CBD #1	0	9:02	9:02	78	25
ART #1	0	4:13	4:13	85	19
CBD #2	0	9:00	9:00	86	27
ART #2	0	4:08	4:08	87	19
CBD #3	0	8:53	8:53	86	25
COMMUTER	0	6:01	6:01	87	22
Total Fuel: 137 SCF					
20 minute idle : Total Fuel Used = 48 SCF					
No Load Flow Rate at Idle = 2.30 SCFM			No Load Flow Rate at Full Throttle = 4.32 SCFM		
Heating Value = 1,008.1 BTU/LB					
Comments: None noted.					

FUEL ECONOMY SUMMARY SHEET

BUS MANUFACTURER :Glaval
 BUS MODEL :28' Titan II LF
 BUS NUMBER :1120
 TEST DATE :08/01/12

FUEL TYPE : NATURAL GAS
 SP. GRAVITY : .5570
 HEATING VALUE : 1008.10 BTU/cf
 FUEL TEMPERATURE : 83.00 deg F
 Standard Conditions : 60 deg F and 14.7 psi
 Density of Air : 0.0729 lb/scf

CYCLE	TOTAL FUEL USED (Scf)	TOTAL MILES	FUEL ECONOMY M/Scf(Measured)	FUEL ECONOMY M/Lb(Corrected)
-------	--------------------------	-------------	---------------------------------	---------------------------------

Run # :1, CCW

CBD	72.0	5.73	.08	1.96
ART	38.0	3.82	.10	2.48
COM	24.0	3.82	.16	3.92
TOTAL	134.0	13.37	.10	2.46

Run # :2, CW

CBD	78.0	5.73	.07	1.81
ART	38.0	3.82	.10	2.48
COM	25.0	3.82	.15	3.76
TOTAL	141.0	13.37	.09	2.34

Run # :3, CCW

CBD	76.0	5.73	.08	1.86
ART	38.0	3.82	.10	2.48
COM	23.0	3.82	.17	4.09
TOTAL	137.0	13.37	.10	2.40

Run # :4, CW

CBD	77.0	5.73	.07	1.83
ART	38.0	3.82	.10	2.48
COM	22.0	3.82	.17	4.28
TOTAL	137.0	13.37	.10	2.40

IDLE CONSUMPTION (MEASURED)

First 20 Minutes Data : 40.0 Scf Last 20 Minutes Data : 48.0 Scf
 Average Idle Consumption : 132.0 Scf/Hr

RUN CONSISTENCY: % Difference from overall average of total fuel used

Run 1 : 2.4 Run 2 : -2.7 Run 3 : .2 Run 4 : .2

SUMMARY (CORRECTED VALUES)

Average Idle Consumption : 5.36 LB/Hr
 Average CBD Phase Consumption : 1.86 M/Lb
 Average Arterial Phase Consumption : 2.48 M/Lb
 Average Commuter Phase Consumption : 4.01 M/Lb
 Overall Average Fuel Consumption : 2.40 M/Lb
 Overall Average Fuel Consumption : 96.66 Miles/ Million BTU

7. NOISE

7.1 INTERIOR NOISE AND VIBRATION TESTS

7.1-I. TEST OBJECTIVE

The objective of these tests is to measure and record interior noise levels and check for audible vibration under various operating conditions.

7.1-II. TEST DESCRIPTION

During this series of tests, the interior noise level will be measured at several locations with the bus operating under the following three conditions:

1. With the bus stationary, a white noise generating system shall provide a uniform sound pressure level equal to 80 dB(A) on the left, exterior side of the bus. The engine and all accessories will be switched off and all openings including doors and windows will be closed. This test will be performed at the ABTC.
2. The bus accelerating at full throttle from a standing start to 35 mph on a level pavement. All openings will be closed and all accessories will be operating during the test. This test will be performed on the track at the Test Track Facility.
3. The bus will be operated at various speeds from 0 to 55 mph with and without the air conditioning and accessories on. Any audible vibration or rattles will be noted. This test will be performed on the test segment between the Test Track and the Bus Testing Center.

All tests will be performed in an area free from extraneous sound-making sources or reflecting surfaces. The ambient sound level as well as the surrounding weather conditions will be recorded in the test data.

7.1-III. DISCUSSION

This test is performed in three parts. The first part exposes the exterior of the vehicle to 80.0 dB(A) on the left side of the bus and the noise transmitted to the interior is measured. The overall average of the six measurements was 51.3 dB(A); ranging from 49.0 dB(A) at the driver's seat to 53.1 dB(A) in line with the middle speaker. The interior ambient noise level for this test was < 30.0 dB(A).

The second test measures interior noise during acceleration from 0 to 35 mph. This noise level ranged from 76.0 dB(A) at the rear passenger seats to 78.8 dB(A) at the front passenger seats. The overall average was 77.1 dB(A). The interior ambient noise level for this test was < 30.0 dB(A).

The third part of the test is to listen for resonant vibrations, rattles, and other noise sources while operating over the road. No vibrations or rattles were noted.

INTERIOR NOISE TEST DATA FORM
Test Condition 1: 80 dB(A) Stationary White Noise

Page 1 of 3

Bus Number: 1120	Date: 1-6-12
Personnel: E.D. & E.L.	
Temperature (°F): 43	Humidity (%): 53
Wind Speed (mph): 5	Wind Direction: SW
Barometric Pressure (in.Hg): 29.85	
Initial Sound Level Meter Calibration: ■ checked by: E.D.	
Interior Ambient Noise Level dB(A): < 30.0	Exterior Ambient Noise Level dB(A): 48.1
Microphone Height During Testing (in): 29" above seat cushion	

Measurement Location	Measured Sound Level dB(A)
Driver's Seat	49.0
Front Passenger Seats	51.4
In Line with Front Speaker	49.3
In Line with Middle Speaker	53.1
In Line with Rear Speaker	52.8
Rear Passenger Seats	52.1

Final Sound Level Meter Calibration: ■ checked by: E.D.

Comments: All readings taken in the center aisle.
Remarks/comments/recommended changes: None noted.

INTERIOR NOISE TEST DATA FORM
Test Condition 2: 0 to 35 mph Acceleration Test

Page 2 of 3

Bus Number: 1120	Date: 7-17-12
Personnel: M.R., T.S. & S.R.	
Temperature (°F): 79	Humidity (%): 54
Wind Speed (mph): 8	Wind Direction: SW
Barometric Pressure (in.Hg): 29.93	
Initial Sound Level Meter Calibration: ■ checked by: T.S.	
Interior Ambient Noise Level dB(A): < 30.0	Exterior Ambient Noise Level dB(A): 42.0
Microphone Height During Testing (in): 29" above seat cushion	

Measurement Location	Measured Sound Level dB(A)
Driver's Seat	76.2
Front Passenger Seats	78.8
Middle Passenger Seats	77.3
Rear Passenger Seats	76.0

Final Sound Level Meter Calibration: ■ checked by: T.S.

Comments: All readings taken in the center aisle.
Remarks/comments/recommended changes: None noted.

INTERIOR NOISE TEST DATA FORM **Test Condition 3: Audible Vibration Test**

Page 3 of 3

Bus Number: 1120	Date: 7-17-12
Personnel: M.R., T.S. & S.R.	
Temperature (°F): 79	Humidity (%): 54
Wind Speed (mph): 8	Wind Direction: SW
Barometric Pressure (in.Hg): 29.93	

Describe the following possible sources of noise and give the relative location on the bus.

Source of Noise	Location
Engine and Accessories	None noted.
Windows and Doors	None noted.
Seats and Wheel Chair lifts	None noted.

Comment on any other vibration or noise source which may have occurred that is not described above: None noted.
Remarks/comments/recommended changes: None noted.

7.1 INTERIOR NOISE TEST



**TEST BUS SET-UP FOR 80 dB(A)
INTERIOR NOISE TEST**

7.2 EXTERIOR NOISE TESTS

7.2-I. TEST OBJECTIVE

The objective of this test is to record exterior noise levels when a bus is operated under various conditions.

7.2-II. TEST DESCRIPTION

In the exterior noise tests, the bus will be operated at a SLW in three different conditions using a smooth, straight and level roadway:

1. Accelerating at full throttle from a constant speed at or below 35 mph and just prior to transmission up shift.
2. Accelerating at full throttle from standstill.
3. Stationary, with the engine at low idle, high idle, and wide open throttle.

In addition, the buses will be tested with and without the air conditioning and all accessories operating. The exterior noise levels will be recorded.

The test site is at the PSBRTF and the test procedures will be in accordance with SAE Standards SAE J366b, Exterior Sound Level for Heavy Trucks and Buses. The test site is an open space free of large reflecting surfaces. A noise meter placed at a specified location outside the bus will measure the noise level.

During the test, special attention should be paid to:

1. The test site characteristics regarding parked vehicles, signboards, buildings, or other sound-reflecting surfaces
2. Proper usage of all test equipment including set-up and calibration
3. The ambient sound level

7.2-III. DISCUSSION

The Exterior Noise Test determines the noise level generated by the vehicle under different driving conditions and at stationary low and high idle, with and without air conditioning and accessories operating. The test site is a large, level, bituminous paved area with no reflecting surfaces nearby.

With an exterior ambient noise level of 44.7 dB(A), the average test result obtained while accelerating from a constant speed was 71.3 dB(A) on the right side and 76.3 dB(A) on the left side.

When accelerating from a standstill with an exterior ambient noise level of 44.7 dB(A), the average of the results obtained were 76.1 dB(A) on the right side and 76.5 dB(A) on the left side.

With the vehicle stationary and the engine, accessories, and air conditioning on, the measurements averaged 50.1 dB(A) at low idle, 62.8 dB(A) at high idle, and 71.3 dB(A) at wide open throttle. With the accessories and air conditioning off, the readings averaged 1.4 dB(A) lower at low idle, 1.4 dB(A) lower at high idle, and 0.1 dB(A) lower at wide open throttle. The exterior ambient noise level measured during this test was 44.7 dB(A).

EXTERIOR NOISE TEST DATA FORM

Accelerating from Constant Speed

Page 1 of 3

Bus Number: 1120	Date: 7-17-12
Personnel: M.R., T.S. & S.R.	
Temperature (°F): 85	Humidity (%): 36
Wind Speed (mph): 9	Wind Direction: WNW
Barometric Pressure (in.Hg): 29.89	
Verify that microphone height is 4 feet, wind speed is less than 12 mph and ambient temperature is between 30°F and 90°F: ■ checked by: T.S.	
Initial Sound Level Meter Calibration: ■ checked by: T.S.	
Exterior Ambient Noise Level dB(A): 44.7	

Accelerating from Constant Speed Curb (Right) Side		Accelerating from Constant Speed Street (Left) Side	
Run #	Measured Noise Level dB(A)	Run #	Measured Noise Level dB(A)
1	71.1	1	74.1
2	69.7	2	74.0
3	70.6	3	76.8
4	71.4	4	73.4
5	70.6	5	75.8
Average of two highest actual noise levels = 71.3 dB(A)		Average of two highest actual noise levels = 76.3 dB(A)	
Final Sound Level Meter Calibration Check: ■ checked by: T.S.			
Remarks/Comments/recommended changes: None noted.			

EXTERIOR NOISE TEST DATA FORM

Accelerating from Standstill

Page 2 of 3

Bus Number: 1120	Date: 7-17-12
Personnel: M.R., T.S. & S.R.	
Temperature (°F): 85	Humidity (%): 36
Wind Speed (mph): 9	Wind Direction: WNW
Barometric Pressure (in.Hg): 29.89	
Verify that microphone height is 4 feet, wind speed is less than 12 mph and ambient temperature is between 30°F and 90°F: ■ checked by: T.S.	
Initial Sound Level Meter Calibration: ■ checked by: T.S.	
Exterior Ambient Noise Level dB(A): 44.7	

Accelerating from Standstill Curb (Right) Side		Accelerating from Standstill Street (Left) Side	
Run #	Measured Noise Level dB(A)	Run #	Measured Noise Level dB(A)
1	76.1	1	76.7
2	74.6	2	75.2
3	76.0	3	76.0
4	75.8	4	76.2
5	74.1	5	75.5
Average of two highest actual noise levels = 76.1 dB(A)		Average of two highest actual noise levels = 76.5 dB(A)	
Final Sound Level Meter Calibration Check: ■ checked by: T.S.			
Remarks/comments/recommended changes: None noted.			

EXTERIOR NOISE TEST DATA FORM**Stationary**

Page 3 of 3

Bus Number: 1120		Date: 7-17-12	
Personnel: M.R., T.S. & S.R.			
Temperature (°F): 85		Humidity (%): 36	
Wind Speed (mph): 9		Wind Direction: WNW	
Barometric Pressure (in.Hg): 29.89			
Verify that microphone height is 4 feet, wind speed is less than 12 mph and ambient temperature is between 30°F and 90°F: ■ checked by: T.S.			
Initial Sound Level Meter Calibration: ■ checked by: T.S.			
Exterior Ambient Noise Level dB(A): 44.7			
Accessories and Air Conditioning ON			
Throttle Position	Engine RPM	Curb (Right) Side dB(A)	Street (Left) Side db(A)
		Measured	Measured
Low Idle	700	49.5	50.7
High Idle	1,400	61.9	63.7
Wide Open Throttle	3,900	71.5	71.1
Accessories and Air Conditioning OFF			
Throttle Position	Engine RPM	Curb (Right) Side dB(A)	Street (Left) Side db(A)
		Measured	Measured
Low Idle	700	47.0	50.3
High Idle	1,400	61.0	61.8
Wide Open Throttle	3,900	71.8	70.5
Final Sound Level Meter Calibration Check: ■ checked by: T.S.			
Remarks/Comments/recommended changes: None noted.			

7.2 EXTERIOR NOISE TESTS



**TEST BUS UNDERGOING
EXTERIOR NOISE TESTING**



8. EMISSIONS TEST – DYNAMOMETER-BASED EMISSIONS TEST USING TRANSIT DRIVING CYCLES

8-I. TEST OBJECTIVE

The objective of this test is to provide comparable emissions data on transit buses produced by different manufacturers. This chassis-based emissions test bears no relation to engine certification testing performed for compliance with the Environmental Protection Agency (EPA) regulation. EPA's certification tests are performed using an engine dynamometer operating under the Federal Test Protocol. This emissions test is a measurement of the gaseous engine emissions CO, CO₂, NO_x, HC and particulates (diesel vehicles) produced by a vehicle operating on a large-roll chassis dynamometer. The test is performed for three differed driving cycles intended to simulate a range of transit operating environments. The cycles consist of Manhattan Cycle, the Orange County Bus driving cycle, and the Urban Dynamometer Driving Cycle (UDDS). The test is performed under laboratory conditions in compliance with EPA 1065 and SAE J2711. The results of this test may not represent actual in-service vehicle emissions but will provide data that can be used by recipients to compare buses tested under different operating conditions.

8-II. TEST DESCRIPTION

This test is performed in the emissions bay of the LTI Vehicle Testing Laboratory. The Laboratory is equipped with a Schenk Pegasus 300 HP, large-roll (72 inch diameter) chassis dynamometer suitable for heavy-vehicle emissions testing. The dynamometer is located in the end test bay and is adjacent to the control room and emissions analysis area. The emissions laboratory provides capability for testing heavy-duty diesel and alternative-fueled buses for a variety of tailpipe emissions including particulate matter, oxides of nitrogen, carbon monoxide, carbon dioxide, and hydrocarbons. It is equipped with a Horiba full-scale CVS dilution tunnel and emissions sampling system. The system includes Horiba Mexa 7400 Series gas analyzers and a Horiba HF47 Particulate Sampling System. Test operation is automated using Horiba CDTCS software. The computer controlled dynamometer is capable of simulating over-the-road operation for a variety of vehicles and driving cycles.

The emissions test will be performed as soon as permissible after the completion of the GVW portion of the structural durability test. The driving cycles are the Manhattan cycle, a low average speed, highly transient urban cycle (Figure 1), the Orange County Bus Cycle which consists of urban and highway driving segments (Figure 2), and the EPA UDDS Cycle (Figure 3). An emissions test will comprise of two runs for the three different driving cycles, and the average value will be reported. Test results reported will include the average grams per mile value for each of the gaseous emissions for

gasoline buses, for all the three driving cycles. In addition, the particulate matter emissions are included for diesel buses, and non-methane hydrocarbon emissions (NMHC) are included for CNG buses. Testing is performed in accordance with EPA CFR49, Part 1065 and SAE J2711 as practically determined by the FTA Emissions Testing Protocol developed by West Virginia University and Penn State University.

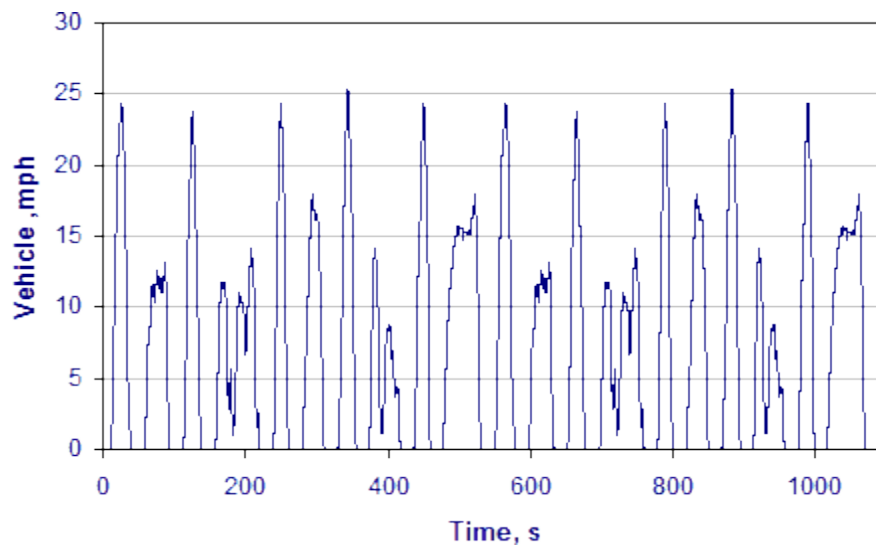


Figure 1. *Manhattan Driving Cycle (duration 1089 sec, Maximum speed 25.4mph, average speed 6.8mph)*

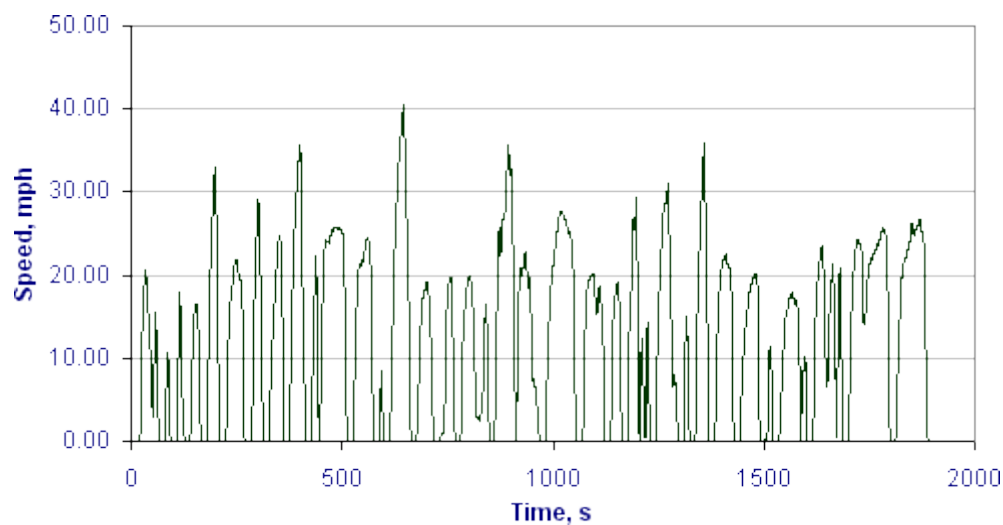


Figure 2. *Orange County Bus Cycle (Duration 1909 Sec, Maximum Speed 41mph, Average Speed 12mph)*

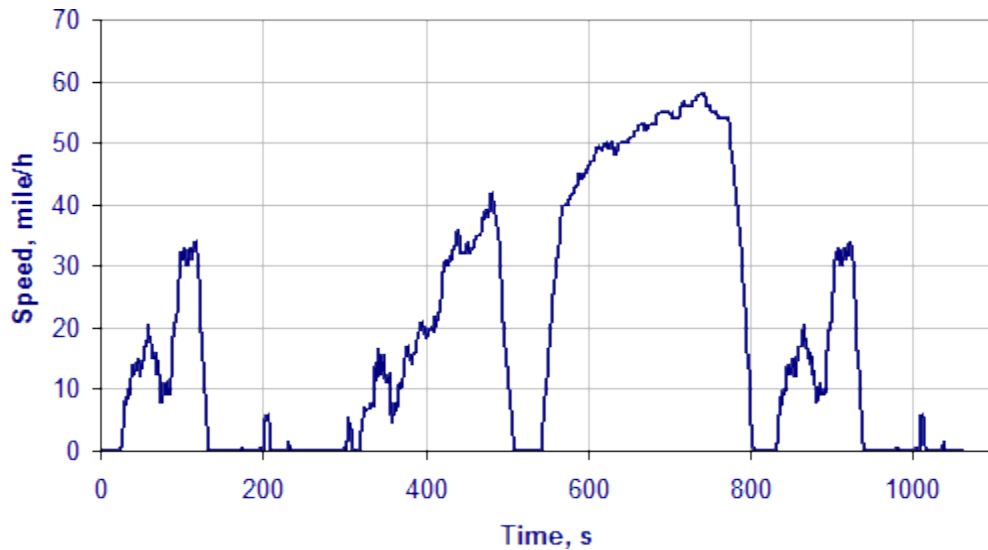


Figure 3. HD-UDDS Cycle (duration 1060seconds, Maximum Speed 58mph, Average Speed 18.86mph)

8-III. TEST ARTICLE

The test article is a Glaval Bus model 28' Titan II LF transit bus equipped with CNG fueled General Motors 6.0 L engine. The bus was tested on August 17, 2012.

8-IV. TEST EQUIPMENT

Testing is performed in the LTI Vehicle Testing Laboratory emissions testing bay. The test bay is equipped with a Schenk Pegasus 72-inch, large-roll chassis dynamometer. The dynamometer is electronically controlled to account for vehicle road-load characteristics and for simulating the inertia characteristics of the vehicle. Power to the roller is supplied and absorbed through an electronically controlled 3-phase ac motor. Absorbed power is dumped back onto the electrical grid.

Vehicle exhaust is collected by a Horiba CVS, full-flow dilution tunnel. The system has separate tunnels for diesel and gasoline/natural gas fueled vehicles. In the case of diesel vehicles, particulate emissions are measured gravimetrically using 47mm Teflon filters. These filters are housed in a Horiba HF47 particulate sampler, per EPA 1065 test procedures.. Heated gaseous emissions of hydrocarbons and NOx are sampled by Horiba heated oven analyzers. Gaseous

emissions for CO, CO₂ and cold NO_x are measured using a Horiba Mexa 7400 series gas analyzer. System operation, including the operation of the chassis dynamometer, and all calculations are controlled by a Dell workstation running Horiba CDCTS test control software. Particulate Filters are weighed in a glove box using a Sartorius microbalance accurate to 1 microgram.

8-V. TEST PREPARATION AND PROCEDURES

All vehicles are prepared for emissions testing in accordance with the Fuel Economy Pre-Test Maintenance Form. (In the event that fuel economy test was performed immediately prior to emissions testing this step does not have to be repeated) This is done to ensure that the bus is tested in optimum operating condition. The manufacturer-specified preventive maintenance shall be performed before this test. The ABS system and when applicable, the regenerative braking system are disabled for operation on the chassis dynamometer. Any manufacturer-recommended changes to the pre-test maintenance procedure must be noted on the revision sheet. The Fuel Economy Pre-Test Inspection Form will also be completed before performing. Both the Fuel Economy Pre-Test Maintenance Form and the Fuel Economy Pre-Test Inspection Form are found on the following pages.

Prior to performing the emissions test, each bus is evaluated to determine its road-load characteristics using coast-down techniques in accordance with SAE J1263. This data is used to program the chassis dynamometer to accurately simulate over-the-road operation of the bus.

Warm-up consists of driving the bus for 20 minutes at approximately 40 mph on the chassis dynamometer. The test driver follows the prescribed driving cycle watching the speed trace and instructions on the Horiba Drivers-Aid monitor which is placed in front of the windshield. The CDCTS computer monitors driver performance and reports any errors that could potentially invalidate the test.

All buses are tested at half seated load weight. The base line emissions data are obtained at the following conditions:

1. Air conditioning off
2. Evaporator fan or ventilation fan on
3. One Half Seated load weight
4. Appropriate test fuel with energy content (BTU/LB) noted in CDTCS software
5. Exterior and interior lights on
6. Heater Pump Motor off
7. Defroster off
8. Windows and Doors closed

The test tanks or the bus fuel tank(s) will be filled prior to the fuel economy test with the appropriate grade of test fuel.

8-VI DISCUSSION

The following Table 1 provides the emissions testing results on a grams per mile basis for each of the exhaust constituents measured and for each driving cycle performed.

TABLE 1 Emissions Test Results

Driving Cycle	Manhattan	Orange County Bus	UDDS
CO₂, gm/mi	1,498	976	757
CO, gm/mi	0.60	0.42	0.42
THC, gm/mi	0.10	0.11	0.14
NMHC, gm/mi	0.01	0.01	0.01
NO_x, gm/mi	0	0	0
Particulates. gm/mi	na	na	Na
Fuel consumption scf/mi	26.9	17.5	13.6

FUEL ECONOMY/EMISSIONS PRE-TEST MAINTENANCE FORM

Page 1 of 3

Bus Number: 1120	Date: 7-31-12	SLW (lbs): 12,720
Personnel: E.D. & E.L.		

FUEL SYSTEM	OK	Date	Initials
Install fuel measurement system	✓	7/31/12	E.D.
Replace fuel filter	✓	7/31/12	E.D.
Check for fuel leaks	✓	7/31/12	E.D.
Specify fuel type (refer to fuel analysis)	CNG		
Remarks: None noted.			
BRAKES/TIRES	OK	Date	Initials
Inspect hoses	✓	7/31/12	E.L.
Inspect brakes	✓	7/31/12	E.L.
Relube wheel bearings	✓	7/31/12	E.L.
Check tire inflation pressures (mfg. specs.)	✓	7/31/12	E.L.
Remarks: None noted.			
COOLING SYSTEM	OK	Date	Initials
Check hoses and connections	✓	7/31/12	E.D.
Check system for coolant leaks	✓	7/31/12	E.D.
Remarks: None noted.			

FUEL ECONOMY/EMISSIONS PRE-TEST MAINTENANCE FORM

Page 2 of 3

Bus Number: 1120	Date: 7-31-12		
Personnel: E.D. & E.L.			
ELECTRICAL SYSTEMS	OK	Date	Initials
Check battery	✓	7/31/12	E.L.
Inspect wiring	✓	7/31/12	E.L.
Inspect terminals	✓	7/31/12	E.L.
Check lighting	✓	7/31/12	E.L.
Remarks: None noted.			
DRIVE SYSTEM	OK	Date	Initials
Drain transmission fluid	✓	7/31/12	E.D.
Replace filter/gasket	✓	7/31/12	E.D.
Check hoses and connections	✓	7/31/12	E.D.
Replace transmission fluid	✓	7/31/12	E.D.
Check for fluid leaks	✓	7/31/12	E.D.
Remarks: None noted.			
LUBRICATION	OK	Date	Initials
Drain crankcase oil	✓	7/31/12	E.L.
Replace filters	✓	7/31/12	E.L.
Replace crankcase oil	✓	7/31/12	E.L.
Check for oil leaks	✓	7/31/12	E.L.
Check oil level	✓	7/31/12	E.L.
Lube all chassis grease fittings	✓	7/31/12	E.L.
Lube universal joints	✓	7/31/12	E.L.
Replace differential lube including axles	✓	7/31/12	E.L.
Remarks: None noted.			

FUEL ECONOMY/EMISSIONS PRE-TEST MAINTENANCE FORM

Page 3 of 3

Bus Number: 1120	Date: 7-31-12		
Personnel: E.D. & E.L.			
EXHAUST/EMISSION SYSTEM	OK	Date	Initials
Check for exhaust leaks	✓	7/31/12	
Remarks: None noted.			
ENGINE	OK	Date	Initials
Replace air filter	✓	7/31/12	E.D.
Inspect air compressor and air system	✓	7/31/12	E.D.
Inspect vacuum system, if applicable	✓	7/31/12	E.D.
Check and adjust all drive belts	✓	7/31/12	E.D.
Check cold start assist, if applicable	✓	7/31/12	E.D.
Remarks: None noted.			
STEERING SYSTEM	OK	Date	Initials
Check power steering hoses and connectors	✓	7/31/12	E.L.
Service fluid level	✓	7/31/12	E.L.
Check power steering operation	✓	7/31/12	E.L.
Remarks: None noted.			
	OK	Date	Initials
Ballast bus to seated load weight	✓	7/31/12	E.D.
TEST DRIVE	OK	Date	Initials
Check brake operation	✓	7/31/12	E.D.
Check transmission operation	✓	7/31/12	E.D.
Remarks: None noted.			

FUEL ECONOMY/EMISSIONS PRE-TEST INSPECTION FORM

Page 1 of 1

Bus Number: 1120	Date: 8-1-12
Personnel: B.L. & E.D.	
PRE WARM-UP	If OK, Initial
Fuel Economy Pre-Test Maintenance Form is complete	E.D.
Cold tire pressure (psi): Front <u>65</u> Middle <u>N/A</u> Rear <u>60</u>	E.D.
Tire wear:	E.D.
Engine oil level	E.D.
Engine coolant level	E.D.
Interior and exterior lights on, evaporator fan on	B.L.
Fuel economy instrumentation installed and working properly.	B.L.
Fuel line -- no leaks or kinks	B.L.
Speed measuring system installed on bus. Speed indicator installed in front of bus and accessible to TECH and Driver.	B.L.
Bus is loaded to SLW	E.D.
WARM-UP	If OK, Initial
Bus driven for at least one hour warm-up	B.L.
No extensive or black smoke from exhaust	B.L.
POST WARM-UP	If OK, Initial
Warm tire pressure (psi): Front <u>68</u> Middle <u>N/A</u> Rear <u>62</u>	B.L.
Environmental conditions Average wind speed <12 mph and maximum gusts <15 mph Ambient temperature between 30°F(-1C°) and 90°F(32°C) Track surface is dry Track is free of extraneous material and clear of interfering traffic	B.L.

